



**APPROVED JURISDICTIONAL DETERMINATION FORM**  
**U.S. Army Corps of Engineers**

This form should be completed by following the instructions provided in Section IV of the JD Form Instructional Guidebook.

**SECTION I: BACKGROUND INFORMATION**

**A. REPORT COMPLETION DATE FOR APPROVED JURISDICTIONAL DETERMINATION (JD):** May 30, 2018

**B. DISTRICT OFFICE, FILE NAME, AND NUMBER:** Jacksonville District, Tampa Office, 12619 DEAD RIVER RD, SAJ-2018-01047.

**C. PROJECT LOCATION AND BACKGROUND INFORMATION:**

State: FL County/parish/borough: Lake City: Tavares  
 Center coordinates of site (lat/long in degree decimal format): Lat. 28.801750° **N**, Long. 81.747753° **W**.  
 Universal Transverse Mercator:

Name of nearest waterbody: Dora Canal

Name of nearest Traditional Navigable Water (TNW) into which the aquatic resource flows: Lake Dora

Name of watershed or Hydrologic Unit Code (HUC): 03080102

Check if map/diagram of review area and/or potential jurisdictional areas is/are available upon request.

Check if other sites (e.g., offsite mitigation sites, disposal sites, etc...) are associated with this action and are recorded on a different JD form.

**D. REVIEW PERFORMED FOR SITE EVALUATION (CHECK ALL THAT APPLY):**

Office (Desk) Determination. Date: May 30, 2018

Field Determination. Date(s): April 26, 2018

**SECTION II: SUMMARY OF FINDINGS**

**A. RHA SECTION 10 DETERMINATION OF JURISDICTION.**

There **Appear to be no** "navigable waters of the U.S." within Rivers and Harbors Act (RHA) jurisdiction (as defined by 33 CFR part 329) in the review area. [Required]

Waters subject to the ebb and flow of the tide.

Waters are presently used, or have been used in the past, or may be susceptible for use to transport interstate or foreign commerce.  
 Explain: .

**B. CWA SECTION 404 DETERMINATION OF JURISDICTION.**

There **are and are not** "waters of the U.S." within Clean Water Act (CWA) jurisdiction (as defined by 33 CFR part 328) in the review area. [Required]

**1. Waters of the U.S.**

**a. Indicate presence of waters of U.S. in review area (check all that apply):<sup>1</sup>**

- TNWs, including territorial seas
- Wetlands adjacent to TNWs
- Relatively permanent waters<sup>2</sup> (RPWs) that flow directly or indirectly into TNWs
- Non-RPWs that flow directly or indirectly into TNWs
- Wetlands directly abutting RPWs that flow directly or indirectly into TNWs
- Wetlands adjacent to but not directly abutting RPWs that flow directly or indirectly into TNWs
- Wetlands adjacent to non-RPWs that flow directly or indirectly into TNWs
- Impoundments of jurisdictional waters
- Isolated (interstate or intrastate) waters, including isolated wetlands

**b. Identify (estimate) size of waters of the U.S. in the review area:**

Non-wetland waters: linear feet: width (ft) and/or 6.26 acres.  
 Wetlands: 0.25 acres.

**c. Limits (boundaries) of jurisdiction based on: 1987 Delineation Manual**

Elevation of established OHWM (if known): .

**2. Non-regulated waters/wetlands (check if applicable):<sup>3</sup>**

Potentially jurisdictional waters and/or wetlands were assessed within the review area and determined to be not jurisdictional.

Explain: **The 41 acre project site is uplands except for a 0.25-acre isolated wetland (Wetland 2) and a 6.26-acre man-made canal system (Wetland 1), which is classified as a RPW. Historical aeriels show Wetland 2 has existed since before 1958 when it was part of a larger system that has since lost its hydrology due to the large ditch/canal system. Wetland 2 is a depressional palustrine forested, Broad-Leaved Deciduous system (PFO1) with no hydrologic**

<sup>1</sup> Boxes checked below shall be supported by completing the appropriate sections in Section III below.

<sup>2</sup> For purposes of this form, an RPW is defined as a tributary that is not a TNW and that typically flows year-round or has continuous flow at least "seasonally" (e.g., typically 3 months).

<sup>3</sup> Supporting documentation is presented in Section III.F.

**connection to any other surface tributary. From review of USGS Quadrangle maps (1960, 1969, 1972, 1981, and 1987) it appears elevation contours would direct surface drainage to the east..**

**SECTION III: CWA ANALYSIS**

**A. TNWs AND WETLANDS ADJACENT TO TNWs**

The agencies will assert jurisdiction over TNWs and wetlands adjacent to TNWs. If the aquatic resource is a TNW, complete Section III.A.1 and Section III.D.1. only; if the aquatic resource is a wetland adjacent to a TNW, complete Sections III.A.1 and 2 and Section III.D.1.; otherwise, see Section III.B below.

**1. TNW**

Identify TNW: .

Summarize rationale supporting determination: .

**2. Wetland adjacent to TNW**

Summarize rationale supporting conclusion that wetland is “adjacent”:

**B. CHARACTERISTICS OF TRIBUTARY (THAT IS NOT A TNW) AND ITS ADJACENT WETLANDS (IF ANY):**

This section summarizes information regarding characteristics of the tributary and its adjacent wetlands, if any, and it helps determine whether or not the standards for jurisdiction established under *Rapanos* have been met.

The agencies will assert jurisdiction over non-navigable tributaries of TNWs where the tributaries are “relatively permanent waters” (RPWs), i.e. tributaries that typically flow year-round or have continuous flow at least seasonally (e.g., typically 3 months). A wetland that directly abuts an RPW is also jurisdictional. If the aquatic resource is not a TNW, but has year-round (perennial) flow, skip to Section III.D.2. If the aquatic resource is a wetland directly abutting a tributary with perennial flow, skip to Section III.D.4.

A wetland that is adjacent to but that does not directly abut an RPW requires a significant nexus evaluation. Corps districts and EPA regions will include in the record any available information that documents the existence of a significant nexus between a relatively permanent tributary that is not perennial (and its adjacent wetlands if any) and a traditional navigable water, even though a significant nexus finding is not required as a matter of law.

If the waterbody<sup>4</sup> is not an RPW, or a wetland directly abutting an RPW, a JD will require additional data to determine if the waterbody has a significant nexus with a TNW. If the tributary has adjacent wetlands, the significant nexus evaluation must consider the tributary in combination with all of its adjacent wetlands. This significant nexus evaluation that combines, for analytical purposes, the tributary and all of its adjacent wetlands is used whether the review area identified in the JD request is the tributary, or its adjacent wetlands, or both. If the JD covers a tributary with adjacent wetlands, complete Section III.B.1 for the tributary, Section III.B.2 for any onsite wetlands, and Section III.B.3 for all wetlands adjacent to that tributary, both onsite and offsite. The determination whether a significant nexus exists is determined in Section III.C below.

**1. Characteristics of non-TNWs that flow directly or indirectly into TNW**

**(i) General Area Conditions:**

Watershed size: 2780.13 square miles

Drainage area: 2780.13 square miles

Average annual rainfall: inches

Average annual snowfall: inches

**(ii) Physical Characteristics:**

**(a) Relationship with TNW:**

Tributary flows directly into TNW.

Tributary flows through **Pick List** tributaries before entering TNW.

Project waters are **1 (or less)** river miles from TNW.

Project waters are **Pick List** river miles from RPW.

Project waters are **1 (or less)** aerial (straight) miles from TNW.

Project waters are **Pick List** aerial (straight) miles from RPW.

Project waters cross or serve as state boundaries. Explain: .

Identify flow route to TNW<sup>5</sup>: Onsite wetland is continuous offsite, flowing into the Dora Canal..

Tributary stream order, if known: .

<sup>4</sup> Note that the Instructional Guidebook contains additional information regarding swales, ditches, washes, and erosional features generally and in the arid West.

<sup>5</sup> Flow route can be described by identifying, e.g., tributary a, which flows through the review area, to flow into tributary b, which then flows into TNW.

(b) General Tributary Characteristics (check all that apply):

**Tributary is:**  Natural  
 Artificial (man-made). Explain: .  
 Manipulated (man-altered). Explain: Canal excavated within a cypress swamp.

**Tributary properties with respect to top of bank (estimate):**

Average width: 100 feet  
Average depth: 20 feet  
Average side slopes: **2:1**.

**Primary tributary substrate composition (check all that apply):**

Silts  Sands  Concrete  
 Cobbles  Gravel  Muck  
 Bedrock  Vegetation. Type/% cover:  
 Other. Explain: .

**Tributary condition/stability [e.g., highly eroding, sloughing banks]. Explain:** Stable.

**Presence of run/riffle/pool complexes. Explain:** None.

**Tributary geometry:** **Relatively straight**

**Tributary gradient (approximate average slope):** 0-5 %

(c) Flow:

Tributary provides for: **Seasonal flow**

Estimate average number of flow events in review area/year: **20 (or greater)**

Describe flow regime: Runoff and groundwater flow.

Other information on duration and volume: .

Surface flow is: **Confined**. Characteristics: .

Subsurface flow: **Unknown**. Explain findings: .

Dye (or other) test performed: .

Tributary has (check all that apply):

Bed and banks  
 OHWM<sup>6</sup> (check all indicators that apply):  
 clear, natural line impressed on the bank  the presence of litter and debris  
 changes in the character of soil  destruction of terrestrial vegetation  
 shelving  the presence of wrack line  
 vegetation matted down, bent, or absent  sediment sorting  
 leaf litter disturbed or washed away  scour  
 sediment deposition  multiple observed or predicted flow events  
 water staining  abrupt change in plant community  
 other (list):  
 Discontinuous OHWM.<sup>7</sup> Explain: .

If factors other than the OHWM were used to determine lateral extent of CWA jurisdiction (check all that apply):

High Tide Line indicated by:  Mean High Water Mark indicated by:  
 oil or scum line along shore objects  survey to available datum;  
 fine shell or debris deposits (foreshore)  physical markings;  
 physical markings/characteristics  vegetation lines/changes in vegetation types.  
 tidal gauges  
 other (list):

(iii) **Chemical Characteristics:**

Characterize tributary (e.g., water color is clear, discolored, oily film; water quality; general watershed characteristics, etc.).

Explain: Tannic.

Identify specific pollutants, if known: .

<sup>6</sup>A natural or man-made discontinuity in the OHWM does not necessarily sever jurisdiction (e.g., where the stream temporarily flows underground, or where the OHWM has been removed by development or agricultural practices). Where there is a break in the OHWM that is unrelated to the waterbody's flow regime (e.g., flow over a rock outcrop or through a culvert), the agencies will look for indicators of flow above and below the break.

<sup>7</sup>Ibid.

(iv) **Biological Characteristics. Channel supports (check all that apply):**

- Riparian corridor. Characteristics (type, average width): .
- Wetland fringe. Characteristics: .
- Habitat for:
  - Federally Listed species. Explain findings: .
  - Fish/spawn areas. Explain findings: Fish visible in canal.
  - Other environmentally-sensitive species. Explain findings: .
  - Aquatic/wildlife diversity. Explain findings: Waterfowl noted during site visit.

2. **Characteristics of wetlands adjacent to non-TNW that flow directly or indirectly into TNW**

(i) **Physical Characteristics:**

(a) General Wetland Characteristics:

Properties:

Wetland size:        acres

Wetland type. Explain: .

Wetland quality. Explain: .

Project wetlands cross or serve as state boundaries. Explain: .

(b) General Flow Relationship with Non-TNW:

Flow is: **Pick List**. Explain: .

Surface flow is: **Pick List**

Characteristics: .

Subsurface flow: **Pick List**. Explain findings: .

Dye (or other) test performed: .

(c) Wetland Adjacency Determination with Non-TNW:

Directly abutting

Not directly abutting

Discrete wetland hydrologic connection. Explain: .

Ecological connection. Explain: .

Separated by berm/barrier. Explain: .

(d) Proximity (Relationship) to TNW

Project wetlands are **Pick List** river miles from TNW.

Project waters are **Pick List** aerial (straight) miles from TNW.

Flow is from: **Pick List**.

Estimate approximate location of wetland as within the **Pick List** floodplain.

(ii) **Chemical Characteristics:**

Characterize wetland system (e.g., water color is clear, brown, oil film on surface; water quality; general watershed characteristics; etc.). Explain: .

Identify specific pollutants, if known: .

(iii) **Biological Characteristics. Wetland supports (check all that apply):**

Riparian buffer. Characteristics (type, average width): .

Vegetation type/percent cover. Explain: .

Habitat for:

Federally Listed species. Explain findings: .

Fish/spawn areas. Explain findings: .

Other environmentally-sensitive species. Explain findings: .

Aquatic/wildlife diversity. Explain findings: .

3. **Characteristics of all wetlands adjacent to the tributary (if any)**

All wetland(s) being considered in the cumulative analysis: **Pick List**

Approximately (        ) acres in total are being considered in the cumulative analysis.

For each wetland, specify the following:

Directly abuts? (Y/N)      Size (in acres)      Directly abuts? (Y/N)      Size (in acres)

Summarize overall biological, chemical and physical functions being performed: .

### C. SIGNIFICANT NEXUS DETERMINATION

A significant nexus analysis will assess the flow characteristics and functions of the tributary itself and the functions performed by any wetlands adjacent to the tributary to determine if they significantly affect the chemical, physical, and biological integrity of a TNW. For each of the following situations, a significant nexus exists if the tributary, in combination with all of its adjacent wetlands, has more than a speculative or insubstantial effect on the chemical, physical and/or biological integrity of a TNW. Considerations when evaluating significant nexus include, but are not limited to the volume, duration, and frequency of the flow of water in the tributary and its proximity to a TNW, and the functions performed by the tributary and all its adjacent wetlands. It is not appropriate to determine significant nexus based solely on any specific threshold of distance (e.g. between a tributary and its adjacent wetland or between a tributary and the TNW). Similarly, the fact an adjacent wetland lies within or outside of a floodplain is not solely determinative of significant nexus.

Draw connections between the features documented and the effects on the TNW, as identified in the *Rapanos* Guidance and discussed in the Instructional Guidebook. Factors to consider include, for example:

- Does the tributary, in combination with its adjacent wetlands (if any), have the capacity to carry pollutants or flood waters to TNWs, or to reduce the amount of pollutants or flood waters reaching a TNW?
- Does the tributary, in combination with its adjacent wetlands (if any), provide habitat and lifecycle support functions for fish and other species, such as feeding, nesting, spawning, or rearing young for species that are present in the TNW?
- Does the tributary, in combination with its adjacent wetlands (if any), have the capacity to transfer nutrients and organic carbon that support downstream foodwebs?
- Does the tributary, in combination with its adjacent wetlands (if any), have other relationships to the physical, chemical, or biological integrity of the TNW?

**Note: the above list of considerations is not inclusive and other functions observed or known to occur should be documented below:**

1. **Significant nexus findings for non-RPW that has no adjacent wetlands and flows directly or indirectly into TNWs.** Explain findings of presence or absence of significant nexus below, based on the tributary itself, then go to Section III.D: .
2. **Significant nexus findings for non-RPW and its adjacent wetlands, where the non-RPW flows directly or indirectly into TNWs.** Explain findings of presence or absence of significant nexus below, based on the tributary in combination with all of its adjacent wetlands, then go to Section III.D: .
3. **Significant nexus findings for wetlands adjacent to an RPW but that do not directly abut the RPW.** Explain findings of presence or absence of significant nexus below, based on the tributary in combination with all of its adjacent wetlands, then go to Section III.D: .

### D. DETERMINATIONS OF JURISDICTIONAL FINDINGS. THE SUBJECT WATERS/WETLANDS ARE (CHECK ALL THAT APPLY):

1. **TNWs and Adjacent Wetlands.** Check all that apply and provide size estimates in review area:

- TNWs:      linear feet      width (ft), Or,      acres.  
 Wetlands adjacent to TNWs:      acres.

2. **RPWs that flow directly or indirectly into TNWs.**

- Tributaries of TNWs where tributaries typically flow year-round are jurisdictional. Provide data and rationale indicating that tributary is perennial: .
- Tributaries of TNW where tributaries have continuous flow “seasonally” (e.g., typically three months each year) are jurisdictional. Data supporting this conclusion is provided at Section III.B. Provide rationale indicating that tributary flows seasonally: .

Provide estimates for jurisdictional waters in the review area (check all that apply):

- Tributary waters: linear feet width (ft).  
 Other non-wetland waters: acres.  
Identify type(s) of waters: .

**3. Non-RPWs<sup>8</sup> that flow directly or indirectly into TNWs.**

- Waterbody that is not a TNW or an RPW, but flows directly or indirectly into a TNW, and it has a significant nexus with a TNW is jurisdictional. Data supporting this conclusion is provided at Section III.C.

Provide estimates for jurisdictional waters within the review area (check all that apply):

- Tributary waters: linear feet width (ft).  
 Other non-wetland waters: acres.  
Identify type(s) of waters: .

**4. Wetlands directly abutting an RPW that flow directly or indirectly into TNWs.**

- Wetlands directly abut RPW and thus are jurisdictional as adjacent wetlands.  
 Wetlands directly abutting an RPW where tributaries typically flow year-round. Provide data and rationale indicating that tributary is perennial in Section III.D.2, above. Provide rationale indicating that wetland is directly abutting an RPW: .  
 Wetlands directly abutting an RPW where tributaries typically flow "seasonally." Provide data indicating that tributary is seasonal in Section III.B and rationale in Section III.D.2, above. Provide rationale indicating that wetland is directly abutting an RPW: .

Provide acreage estimates for jurisdictional wetlands in the review area: acres.

**5. Wetlands adjacent to but not directly abutting an RPW that flow directly or indirectly into TNWs.**

- Wetlands that do not directly abut an RPW, but when considered in combination with the tributary to which they are adjacent and with similarly situated adjacent wetlands, have a significant nexus with a TNW are jurisdictional. Data supporting this conclusion is provided at Section III.C.

Provide acreage estimates for jurisdictional wetlands in the review area: acres.

**6. Wetlands adjacent to non-RPWs that flow directly or indirectly into TNWs.**

- Wetlands adjacent to such waters, and have when considered in combination with the tributary to which they are adjacent and with similarly situated adjacent wetlands, have a significant nexus with a TNW are jurisdictional. Data supporting this conclusion is provided at Section III.C.

Provide estimates for jurisdictional wetlands in the review area: acres.

**7. Impoundments of jurisdictional waters.<sup>9</sup>**

As a general rule, the impoundment of a jurisdictional tributary remains jurisdictional.

- Demonstrate that impoundment was created from "waters of the U.S.," or  
 Demonstrate that water meets the criteria for one of the categories presented above (1-6), or  
 Demonstrate that water is isolated with a nexus to commerce (see E below).

**E. ISOLATED [INTERSTATE OR INTRA-STATE] WATERS, INCLUDING ISOLATED WETLANDS, THE USE, DEGRADATION OR DESTRUCTION OF WHICH COULD AFFECT INTERSTATE COMMERCE, INCLUDING ANY SUCH WATERS (CHECK ALL THAT APPLY):<sup>10</sup>**

- which are or could be used by interstate or foreign travelers for recreational or other purposes.  
 from which fish or shellfish are or could be taken and sold in interstate or foreign commerce.  
 which are or could be used for industrial purposes by industries in interstate commerce.  
 Interstate isolated waters. Explain: .  
 Other factors. Explain: .

**Identify water body and summarize rationale supporting determination:** .

<sup>8</sup>See Footnote # 3.

<sup>9</sup> To complete the analysis refer to the key in Section III.D.6 of the Instructional Guidebook.

<sup>10</sup> Prior to asserting or declining CWA jurisdiction based solely on this category, Corps Districts will elevate the action to Corps and EPA HQ for review consistent with the process described in the Corps/EPA Memorandum Regarding CWA Act Jurisdiction Following Rapanos.

Provide estimates for jurisdictional waters in the review area (check all that apply):

- Tributary waters: linear feet width (ft).
- Other non-wetland waters: acres.  
Identify type(s) of waters: .
- Wetlands: acres.

**F. NON-JURISDICTIONAL WATERS, INCLUDING WETLANDS (CHECK ALL THAT APPLY):**

- If potential wetlands were assessed within the review area, these areas did not meet the criteria in the 1987 Corps of Engineers Wetland Delineation Manual and/or appropriate Regional Supplements.
- Review area included isolated waters with no substantial nexus to interstate (or foreign) commerce.
  - Prior to the Jan 2001 Supreme Court decision in "SWANCC," the review area would have been regulated based solely on the "Migratory Bird Rule" (MBR).
- Waters do not meet the "Significant Nexus" standard, where such a finding is required for jurisdiction. Explain: **A site visit revealed no culverts, swales, ditches, or other areas where the existing wetland may connect to the adjacent jurisdictional tributary.**
- Other: (explain, if not covered above): .

Provide acreage estimates for non-jurisdictional waters in the review area, where the sole potential basis of jurisdiction is the MBR factors (i.e., presence of migratory birds, presence of endangered species, use of water for irrigated agriculture), using best professional judgment (check all that apply):

- Non-wetland waters (i.e., rivers, streams): linear feet width (ft).
- Lakes/ponds: acres.
- Other non-wetland waters: acres. List type of aquatic resource: .
- Wetlands: 0.25 acres.

Provide acreage estimates for non-jurisdictional waters in the review area that do not meet the "Significant Nexus" standard, where such a finding is required for jurisdiction (check all that apply):

- Non-wetland waters (i.e., rivers, streams): linear feet, width (ft).
- Lakes/ponds: acres.
- Other non-wetland waters: acres. List type of aquatic resource: .
- Wetlands: 0.25 acres.

**SECTION IV: DATA SOURCES.**

**A. SUPPORTING DATA. Data reviewed for JD (check all that apply - checked items shall be included in case file and, where checked and requested, appropriately reference sources below):**

- Maps, plans, plots or plat submitted by or on behalf of the applicant/consultant: Modica and Associates.
- Data sheets prepared/submitted by or on behalf of the applicant/consultant.
  - Office concurs with data sheets/delineation report.
  - Office does not concur with data sheets/delineation report.
- Data sheets prepared by the Corps: .
- Corps navigable waters' study: .
- U.S. Geological Survey Hydrologic Atlas: .
  - USGS NHD data.
  - USGS 8 and 12 digit HUC maps.
- U.S. Geological Survey map(s). Cite scale & quad name: .
- USDA Natural Resources Conservation Service Soil Survey. Citation: .
- National wetlands inventory map(s). Cite name: .
- State/Local wetland inventory map(s): .
- FEMA/FIRM maps: 12069C0361E, effective on 12/18/2012.
- 100-year Floodplain Elevation is: 63.8 ft (National Geodetic Vertical Datum of 1929)
- Photographs:  Aerial (Name & Date): Google Earth 2017.  
or  Other (Name & Date): .
- Previous determination(s). File no. and date of response letter: .
- Applicable/supporting case law: .
- Applicable/supporting scientific literature: .
- Other information (please specify): .

**B. ADDITIONAL COMMENTS TO SUPPORT JD:** The Corps determined Wetland 2 is isolated and non-jurisdictional. This wetland (Wetland 2 - 0.25 acre) has no apparent hydrologic connection with jurisdictional tributaries. The sites northern and eastern boundary has

been extensively ditched and drained between 1958 -1974. These alterations have lowered the groundwater table on the site and reduced the areal extent of Wetland 2 as well as its hydrologic connections to other waters..

**WETLAND DETERMINATION DATA FORM - Atlantic and Gulf Coastal Plain Region**

Project/Site: Dead River Road City/County: Lake Sampling Date: 05-Feb-18  
 Applicant/Owner: DR Horton State: FL Sampling Point: Upland 1  
 Investigator(s): James Modica IV Section, Township, Range: S 30 T 19S R 26E  
 Landform (hillslope, terrace, etc.): Flat Local relief (concave, convex, none): flat Slope: 0.0 % / 0.0 °  
 Subregion (LRR or MLRA): LRR U Lat.: 28.802049 Long.: -81.746139 Datum: \_\_\_\_\_  
 Soil Map Unit Name: 44-Swamp NWI classification: \_\_\_\_\_

Are climatic/hydrologic conditions on the site typical for this time of year? Yes  No  (If no, explain in Remarks.)  
 Are Vegetation , Soil , or Hydrology  significantly disturbed? Are "Normal Circumstances" present? Yes  No   
 Are Vegetation , Soil , or Hydrology  naturally problematic? (If needed, explain any answers in Remarks.)

**SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.**

Hydrophytic Vegetation Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Hydric Soil Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Wetland Hydrology Present? Yes <input type="radio"/> No <input checked="" type="radio"/>	Is the Sampled Area within a Wetland? Yes <input type="radio"/> No <input checked="" type="radio"/>
---	---

Remarks:  
 This was a swamp that was filled thirty to forty years ago, as evidenced by historical aerials and ground observations.

**HYDROLOGY**

<b>Wetland Hydrology Indicators:</b> Primary Indicators (minimum of one required; check all that apply) <input type="checkbox"/> Surface Water (A1) <input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Marl Deposits (B15) (LRR U) <input type="checkbox"/> Saturation (A3) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Other (Explain in Remarks) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Water-Stained Leaves (B9)	Secondary Indicators (minimum of 2 required) <input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Moss Trim Lines (B16) <input type="checkbox"/> Dry Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> Shallow Aquitard (D3) <input type="checkbox"/> FAC-Neutral Test (D5) <input type="checkbox"/> Sphagnum moss (D8) (LRR T, U)
--	--

<b>Field Observations:</b> Surface Water Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____ Water Table Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____ Saturation Present? (Includes capillary fringe) Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____	Wetland Hydrology Present? Yes <input type="radio"/> No <input checked="" type="radio"/>
---	--

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

**VEGETATION (Five/Four Strata) - Use scientific names of plants.**

Sampling Point: Upland 1

Tree Stratum	(Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	<u>Taxodium distichum</u>	<u>50</u>	<input checked="" type="checkbox"/> 50.0%	<u>OBL</u>
2.	<u>Nyssa biflora</u>	<u>20</u>	<input checked="" type="checkbox"/> 20.0%	<u>OBL</u>
3.	<u>Quercus laurifolia</u>	<u>30</u>	<input checked="" type="checkbox"/> 30.0%	<u>FACW</u>
4.		<u>0</u>	<input type="checkbox"/> 0.0%	
5.		<u>0</u>	<input type="checkbox"/> 0.0%	
6.		<u>0</u>	<input type="checkbox"/> 0.0%	
7.		<u>0</u>	<input type="checkbox"/> 0.0%	
8.		<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>50</u> 20% of Total Cover: <u>20</u>		<u>100</u>	<b>= Total Cover</b>	
Sapling or Sapling/Shrub Stratum	(Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	<u>Prunus caroliniana</u>	<u>30</u>	<input checked="" type="checkbox"/> 100.0%	<u>FACU</u>
2.	<u>Fraxinus americana</u>	<u>10</u>	<input type="checkbox"/> 0.0%	<u>FACU</u>
3.		<u>0</u>	<input type="checkbox"/> 0.0%	
4.		<u>0</u>	<input type="checkbox"/> 0.0%	
5.		<u>0</u>	<input type="checkbox"/> 0.0%	
6.		<u>0</u>	<input type="checkbox"/> 0.0%	
7.		<u>0</u>	<input type="checkbox"/> 0.0%	
8.		<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>20</u> 20% of Total Cover: <u>8</u>		<u>40</u>	<b>= Total Cover</b>	
Shrub Stratum	(Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	<u>Callicarpa americana</u>	<u>10</u>	<input checked="" type="checkbox"/> 25.0%	<u>FACU</u>
2.	<u>Lantana camara</u>	<u>10</u>	<input checked="" type="checkbox"/> 25.0%	<u>FACU</u>
3.	<u>Urena lobata</u>	<u>20</u>	<input checked="" type="checkbox"/> 50.0%	<u>FAC</u>
4.		<u>0</u>	<input type="checkbox"/> 0.0%	
5.		<u>0</u>	<input type="checkbox"/> 0.0%	
6.		<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>20</u> 20% of Total Cover: <u>8</u>		<u>40</u>	<b>= Total Cover</b>	
Herb Stratum	(Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	<u>Carex spp.</u>	<u>10</u>	<input checked="" type="checkbox"/> 0.0%	
2.	<u>Solanum viarum</u>	<u>20</u>	<input type="checkbox"/> 0.0%	<u>UPL</u>
3.	<u>Phytolacca americana</u>	<u>20</u>	<input type="checkbox"/> 0.0%	<u>FACU</u>
4.		<u>0</u>	<input type="checkbox"/> 0.0%	
5.		<u>0</u>	<input type="checkbox"/> 0.0%	
6.		<u>0</u>	<input type="checkbox"/> 0.0%	
7.		<u>0</u>	<input type="checkbox"/> 0.0%	
8.		<u>0</u>	<input type="checkbox"/> 0.0%	
9.		<u>0</u>	<input type="checkbox"/> 0.0%	
10.		<u>0</u>	<input type="checkbox"/> 0.0%	
11.		<u>0</u>	<input type="checkbox"/> 0.0%	
12.		<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>7</u> 20% of Total Cover: <u>3</u>		<u>14</u>	<b>= Total Cover</b>	
Woody Vine Stratum	(Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	<u>Vitis rotundifolia</u>	<u>20</u>	<input checked="" type="checkbox"/> 0.0%	<u>FAC</u>
2.	<u>Passiflora foetida</u>	<u>20</u>	<input type="checkbox"/> 0.0%	<u>FAC</u>
3.		<u>0</u>	<input type="checkbox"/> 0.0%	
4.		<u>0</u>	<input type="checkbox"/> 0.0%	
5.		<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>14</u> 20% of Total Cover: <u>6</u>		<u>20</u>	<b>= Total Cover</b>	

**Dominance Test worksheet:**

Number of Dominant Species That are OBL, FACW, or FAC: 4 (A)

Total Number of Dominant Species Across All Strata: 7 (B)

Percent of dominant Species That Are OBL, FACW, or FAC: 57.1% (A/B)

**Prevalence Index worksheet:**

Total % Cover of:	Multiply by:
OBL species <u>70</u>	x 1 = <u>70</u>
FACW species <u>30</u>	x 2 = <u>60</u>
FAC species <u>27</u>	x 3 = <u>60</u>
FACU species <u>50</u>	x 4 = <u>200</u>
UPL species <u>42</u>	x 5 = <u>0</u>
Column Totals: <u>170</u> (A)	<u>390</u> (B)
Prevalence Index = B/A = <u>2.294</u>	

**Hydrophytic Vegetation Indicators:**

1 - Rapid Test for Hydrophytic Vegetation

2 - Dominance Test is > 50%

3 - Prevalence Index is ≤ 3.0<sup>1</sup>

Problematic Hydrophytic Vegetation<sup>1</sup> (Explain)

<sup>1</sup> Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

**Definition of Vegetation Strata:**

**Tree** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and 3 in. (7.6 cm) or larger in diameter at breast height (DBH).

**Sapling** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and less than 3 in. (7.6 cm) DBH.

**Sapling/Shrub** - Woody plants, excluding vines, less than 3 in. DBH and greater than 3.28 ft (1m) tall.

**Shrub** - Woody plants, excluding woody vines, approximately 3 to 20 ft (1 to 6 m) in height.

**Herb** - All herbaceous (non-woody) plants, including herbaceous vines, regardless of size, and woody plants, except woody vines, less than approximately 3 ft (1 m) in height.

**Woody vine** - All woody vines, regardless of height.

**Hydrophytic Vegetation Present?** Yes  No

Remarks: (If observed, list morphological adaptations below).

\*Indicator suffix = National status or professional decision assigned because Regional status not defined by FWS.

**SOIL**

Sampling Point: Upland 1

**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (Inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	T <sub>voe</sub> <sup>1</sup>	Loc <sup>2</sup>		
0-2	10YR	5/1					Sand	
2-12	10YR	7/1					Sand	
0-5	10YR 6/3	60					Sand	
	10YR 4/4	40						
5-11	10YR 7/2	100					Sand	
11-14	10YR 5/4	100	10YR 3/3	5	C	M	Sand	

<sup>1</sup>Type: C=Concentration. D=Depletion. RM=Reduced Matrix, CS=Covered or Coated Sand Grains <sup>2</sup>Location: PL=Pore Lining, M=Matrix

<p><b>Hydric Soil Indicators:</b></p> <input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> Organic Bodies (A6) (LRR P, T, U) <input type="checkbox"/> 5 cm Mucky Mineral (A7) (LRR P, T, U) <input type="checkbox"/> Muck Presence (A8) (LRR U) <input type="checkbox"/> 1 cm Muck (A9) (LRR P, T) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Coast Prairie Redox (A16) (MLRA 150A) <input type="checkbox"/> Sandy Muck Mineral (S1) (LRR O, S) <input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Dark Surface (S7) (LRR P, S, T, U)	<input type="checkbox"/> Polyvalue Below Surface (S8) (LRR S, T, U) <input type="checkbox"/> Thin Dark Surface (S9) (LRR S, T, U) <input type="checkbox"/> Loamy Mucky Mineral (F1) (LRR O) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8) <input type="checkbox"/> Marl (F10) (LRR U) <input type="checkbox"/> Depleted Ochric (F11) (MLRA 151) <input type="checkbox"/> Iron-Manganese Masses (F12) (LRR O, P, T) <input type="checkbox"/> Umbric Surface (F13) (LRR P, T, U) <input type="checkbox"/> Delta Ochric (F17) (MLRA 151) <input type="checkbox"/> Reduced Vertic (F18) (MLRA 150A, 150B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (MLRA 149A) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 149A, 153C, 153D)	<p><b>Indicators for Problematic Hydric Soils<sup>3</sup>:</b></p> <input type="checkbox"/> 1 cm Muck (A9) (LRR O) <input type="checkbox"/> 2 cm Muck (A10) (LRR S) <input type="checkbox"/> Reduced Vertic (F18) (outside MLRA 150A,B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (LRR P, S, T) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 153B) <input type="checkbox"/> Red Parent Material (TF2) <input type="checkbox"/> Very Shallow Dark Surface (TF12) <input type="checkbox"/> Other (Explain in Remarks)
---	--	--

<sup>3</sup>Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

<p><b>Restrictive Layer (if observed):</b></p> Type: _____ Depth (Inches): _____	<p><b>Hydric Soil Present?</b>    Yes <input type="radio"/>    No <input checked="" type="radio"/></p>
---	--

Remarks:

**WETLAND DETERMINATION DATA FORM - Atlantic and Gulf Coastal Plain Region**

Project/Site: Dead River Road City/County: Lake Sampling Date: 05-Feb-18  
 Applicant/Owner: DR Horton State: FL Sampling Point: Upland 2  
 Investigator(s): James Modica IV Section, Township, Range: S 30 T 19S R 26E  
 Landform (hillslope, terrace, etc.): \_\_\_\_\_ Local relief (concave, convex, none): \_\_\_\_\_ Slope: 0.0 % / 0.0 °  
 Subregion (LRR or MLRA): LRR U Lat.: 28.800585 Long.: -81.746281 Datum: \_\_\_\_\_  
 Soil Map Unit Name: 21- Lake Sand, 0 to 5 Percent Slopes NWI classification: \_\_\_\_\_

Are climatic/hydrologic conditions on the site typical for this time of year? Yes  No  (If no, explain in Remarks.)  
 Are Vegetation , Soil , or Hydrology  significantly disturbed? Are "Normal Circumstances" present? Yes  No   
 Are Vegetation , Soil , or Hydrology  naturally problematic? (If needed, explain any answers in Remarks.)

**SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.**

Hydrophytic Vegetation Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Hydric Soil Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Wetland Hydrology Present? Yes <input type="radio"/> No <input checked="" type="radio"/>	Is the Sampled Area within a Wetland? Yes <input type="radio"/> No <input checked="" type="radio"/>
Remarks:	

**HYDROLOGY**

<b>Wetland Hydrology Indicators:</b>		Secondary Indicators (minimum of 2 required)
Primary Indicators (minimum of one required; check all that apply)		
<input type="checkbox"/> Surface Water (A1) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Water-Stained Leaves (B9)	<input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> Marl Deposits (B15) (LRR U) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Other (Explain in Remarks)	<input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Moss Trim Lines (B16) <input type="checkbox"/> Dry Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> Shallow Aquitard (D3) <input type="checkbox"/> FAC-Neutral Test (D5) <input type="checkbox"/> Sphagnum moss (D8) (LRR T, U)
<b>Field Observations:</b> Surface Water Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____ Water Table Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____ Saturation Present? (Includes capillary fringe) Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____		Wetland Hydrology Present? Yes <input type="radio"/> No <input checked="" type="radio"/>
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:		
Remarks:		

**VEGETATION (Five/Four Strata) - Use scientific names of plants.**

Sampling Point: Upland 2

Tree Stratum	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. <u>Quercus laurifolia</u> (Plot size: <u>30'</u> )	10	<input checked="" type="checkbox"/> 100.0%	FACW
2. _____	0	<input type="checkbox"/> 0.0%	
3. _____	0	<input type="checkbox"/> 0.0%	
4. _____	0	<input type="checkbox"/> 0.0%	
5. _____	0	<input type="checkbox"/> 0.0%	
6. _____	0	<input type="checkbox"/> 0.0%	
7. _____	0	<input type="checkbox"/> 0.0%	
8. _____	0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>5</u> 20% of Total Cover: <u>2</u>	10	<b>= Total Cover</b>	
<b>Sapling or Sapling/Shrub Stratum</b> (Plot size: _____)			
1. _____	0	<input type="checkbox"/> 0.0%	
2. _____	0	<input type="checkbox"/> 0.0%	
3. _____	0	<input type="checkbox"/> 0.0%	
4. _____	0	<input type="checkbox"/> 0.0%	
5. _____	0	<input type="checkbox"/> 0.0%	
6. _____	0	<input type="checkbox"/> 0.0%	
7. _____	0	<input type="checkbox"/> 0.0%	
8. _____	0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>0</u> 20% of Total Cover: <u>0</u>	0	<b>= Total Cover</b>	
<b>Shrub Stratum</b> (Plot size: _____)			
1. _____	0	<input type="checkbox"/> 0.0%	
2. _____	0	<input type="checkbox"/> 0.0%	
3. _____	0	<input type="checkbox"/> 0.0%	
4. _____	0	<input type="checkbox"/> 0.0%	
5. _____	0	<input type="checkbox"/> 0.0%	
6. _____	0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>0</u> 20% of Total Cover: <u>0</u>	0	<b>= Total Cover</b>	
<b>Herb Stratum</b> (Plot size: <u>30'</u> )			
1. <u>Melinis repens</u>	25	<input checked="" type="checkbox"/> 25.0%	UPL
2. <u>Paspalum notatum</u>	50	<input checked="" type="checkbox"/> 50.0%	FACU
3. <u>Lantana camara</u>	10	<input type="checkbox"/> 10.0%	FACU
4. <u>Indigofera hirsuta</u>	15	<input type="checkbox"/> 15.0%	UPL
5. _____	0	<input type="checkbox"/> 0.0%	
6. _____	0	<input type="checkbox"/> 0.0%	
7. _____	0	<input type="checkbox"/> 0.0%	
8. _____	0	<input type="checkbox"/> 0.0%	
9. _____	0	<input type="checkbox"/> 0.0%	
10. _____	0	<input type="checkbox"/> 0.0%	
11. _____	0	<input type="checkbox"/> 0.0%	
12. _____	0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>50</u> 20% of Total Cover: <u>20</u>	100	<b>= Total Cover</b>	
<b>Woody Vine Stratum</b> (Plot size: <u>30'</u> )			
1. <u>Vitis rotundifolia</u>	15	<input checked="" type="checkbox"/> 0.0%	
2. _____	0	<input type="checkbox"/> 0.0%	
3. _____	0	<input type="checkbox"/> 0.0%	
4. _____	0	<input type="checkbox"/> 0.0%	
5. _____	0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>80</u> 20% of Total Cover: <u>30</u>	150	<b>= Total Cover</b>	

**Dominance Test worksheet:**

Number of Dominant Species That are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of dominant Species That Are OBL, FACW, or FAC: 33.3% (A/B)

**Prevalence Index worksheet:**

Total % Cover of:	Multiply by:
OBL species <u>0</u>	x 1 = <u>0</u>
FACW species <u>10</u>	x 2 = <u>20</u>
FAC species <u>150</u>	x 3 = <u>450</u>
FACU species <u>60</u>	x 4 = <u>240</u>
UPL species <u>40</u>	x 5 = <u>200</u>
Column Totals: <u>1250</u>	(A) <u>505</u> (B) <u>460</u>
Prevalence Index = B/A = <u>4.182</u> 4.04	

**Hydrophytic Vegetation Indicators:**

1 - Rapid Test for Hydrophytic Vegetation

2 - Dominance Test is > 50%

3 - Prevalence Index is ≤ 3.0<sup>1</sup>

Problematic Hydrophytic Vegetation<sup>1</sup> (Explain)

<sup>1</sup> Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

**Definition of Vegetation Strata:**

**Tree** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and 3 in. (7.6 cm) or larger in diameter at breast height (DBH).

**Sapling** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and less than 3 in. (7.6 cm) DBH.

**Sapling/Shrub** - Woody plants, excluding vines, less than 3 in. DBH and greater than 3.28 ft (1m) tall.

**Shrub** - Woody plants, excluding woody vines, approximately 3 to 20 ft (1 to 6 m) in height.

**Herb** - All herbaceous (non-woody) plants, including herbaceous vines, regardless of size, and woody plants, except woody vines, less than approximately 3 ft (1 m) in height.

**Woody vine** - All woody vines, regardless of height.

**Hydrophytic Vegetation Present?** Yes  No

Remarks: (If observed, list morphological adaptations below).

\*Indicator suffix = National status or professional decision assigned because Regional status not defined by FWS.

**SOIL**

Sampling Point: Upland 2

**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (Inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Tv <sub>oe</sub> <sup>1</sup>	Loc <sup>2</sup>		
0-7	10YR	3/3	100				Sandy	
7-18	7.5YR	5/4	100				Sandy	
18-33	7.5YR	5/6	100				Sandy	

<sup>1</sup>Type: C=Concentration. D=Depletion. RM=Reduced Matrix, CS=Covered or Coated Sand Grains <sup>2</sup>Location: PL=Pore Lining, M=Matrix

<p><b>Hydric Soil Indicators:</b></p> <input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> Organic Bodies (A6) (LRR P, T, U) <input type="checkbox"/> 5 cm Mucky Mineral (A7) (LRR P, T, U) <input type="checkbox"/> Muck Presence (A8) (LRR U) <input type="checkbox"/> 1 cm Muck (A9) (LRR P, T) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Coast Prairie Redox (A16) (MLRA 150A) <input type="checkbox"/> Sandy Mucky Mineral (S1) (LRR O, S) <input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Dark Surface (S7) (LRR P, S, T, U)	<input type="checkbox"/> Polyvalue Below Surface (S8) (LRR S, T, U) <input type="checkbox"/> Thin Dark Surface (S9) (LRR S, T, U) <input type="checkbox"/> Loamy Mucky Mineral (F1) (LRR O) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8) <input type="checkbox"/> Marl (F10) (LRR U) <input type="checkbox"/> Depleted Ochric (F11) (MLRA 151) <input type="checkbox"/> Iron-Manganese Masses (F12) (LRR O, P, T) <input type="checkbox"/> Umbric Surface (F13) (LRR P, T, U) <input type="checkbox"/> Delta Ochric (F17) (MLRA 151) <input type="checkbox"/> Reduced Vertic (F18) (MLRA 150A, 150B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (MLRA 149A) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 149A, 153C, 153D)	<p><b>Indicators for Problematic Hydric Soils<sup>3</sup>:</b></p> <input type="checkbox"/> 1 cm Muck (A9) (LRR O) <input type="checkbox"/> 2 cm Muck (A10) (LRR S) <input type="checkbox"/> Reduced Vertic (F18) (outside MLRA 150A,B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (LRR P, S, T) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 153B) <input type="checkbox"/> Red Parent Material (TF2) <input type="checkbox"/> Very Shallow Dark Surface (TF12) <input type="checkbox"/> Other (Explain in Remarks)
--	--	--

<sup>3</sup>Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

<p><b>Restrictive Layer (if observed):</b></p> Type: _____ Depth (Inches): _____	<p><b>Hydric Soil Present?</b>    Yes <input type="radio"/>    No <input checked="" type="radio"/></p>
---	--

Remarks:

Upland point taken in an area that was historically a wetland. Man made ditch (approx. 50' - 80' wide, 10' - 25' deep) directly adjacent to the area was cut along property boundary sometime between 1958 and 1974). Ditch has effectively drained hydrology from formally wet area by 10 - 15 feet from surface. Soils are highly dessicated and contain very little organic matter.

**WETLAND DETERMINATION DATA FORM - Atlantic and Gulf Coastal Plain Region**

Project/Site: Dead River Road City/County: Lake Sampling Date: 05-Feb-18  
 Applicant/Owner: DR Horton State: FL Sampling Point: Wetland 1  
 Investigator(s): James Modica IV Section, Township, Range: S T R  
 Landform (hillslope, terrace, etc.): \_\_\_\_\_ Local relief (concave, convex, none): \_\_\_\_\_ Slope: 0.0 % / 0.0 °  
 Subregion (LRR or MLRA): LRR U Lat.: 28.801808 Long.: -81.745133 Datum: \_\_\_\_\_  
 Soil Map Unit Name: 99-Water NWI classification: \_\_\_\_\_

Are climatic/hydrologic conditions on the site typical for this time of year? Yes  No  (If no, explain in Remarks.)  
 Are Vegetation , Soil , or Hydrology  significantly disturbed? Are "Normal Circumstances" present? Yes  No   
 Are Vegetation , Soil , or Hydrology  naturally problematic? (If needed, explain any answers in Remarks.)

**SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.**

Hydrophytic Vegetation Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Hydric Soil Present? Yes <input type="radio"/> No <input checked="" type="radio"/> Wetland Hydrology Present? Yes <input checked="" type="radio"/> No <input type="radio"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="radio"/> No <input type="radio"/>
Remarks: This is a ditch cut through a natural wetland decades ago.	

**HYDROLOGY**

<b>Wetland Hydrology Indicators:</b> Primary Indicators (minimum of one required; check all that apply)		Secondary Indicators (minimum of 2 required)
<input checked="" type="checkbox"/> Surface Water (A1) <input type="checkbox"/> High Water Table (A2) <input checked="" type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Water-Stained Leaves (B9)	<input checked="" type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> Marl Deposits (B15) (LRR U) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Other (Explain in Remarks)	<input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Moss Trim Lines (B16) <input type="checkbox"/> Dry Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input checked="" type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> Shallow Aquitard (D3) <input type="checkbox"/> FAC-Neutral Test (D5) <input type="checkbox"/> Sphagnum moss (D8) (LRR T, U)
<b>Field Observations:</b> Surface Water Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Depth (Inches): <u>0</u> <u>72</u> Water Table Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Depth (Inches): <u>6</u> Saturation Present? (Includes capillary fringe) Yes <input checked="" type="radio"/> No <input type="radio"/> Depth (Inches): <u>0</u>		Wetland Hydrology Present? Yes <input checked="" type="radio"/> No <input type="radio"/>
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:		
Remarks: Wetland point was formerly in open water. USACE Biologist moved wetland point to edge of man-made canal. Very steep embankment. Point approximately 1 ft from existing OHWM.		

**VEGETATION (Five/Four Strata) - Use scientific names of plants.**

Sampling Point: Wetland 1

Tree Stratum (Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. <u>Quercus nigra</u>	<u>10</u>	<input type="checkbox"/> 0.0%	
2. <u>Taxodium distichum</u>	<u>30</u>	<input checked="" type="checkbox"/> 0.0%	
3. <u>Taxodium ascendens</u>	<u>10</u>	<input type="checkbox"/> 0.0%	
4. <u>Nyssa biflora</u>	<u>15</u>	<input checked="" type="checkbox"/> 0.0%	
5. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
6. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
7. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
8. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>30</u> 20% of Total Cover: <u>13</u>	<u>65</u>	<b>= Total Cover</b>	
Sapling or Sapling/Shrub Stratum (Plot size: _____)	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
2. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
3. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
4. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
5. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
6. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
7. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
8. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>0</u> 20% of Total Cover: <u>0</u>	<u>0</u>	<b>= Total Cover</b>	
Shrub Stratum (Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. <u>Liquidambar styraciflua</u>	<u>15</u>	<input checked="" type="checkbox"/> 0.0%	FAC
2. <u>Acer rubrum</u>	<u>10</u>	<input checked="" type="checkbox"/> 0.0%	FAC
3. <u>Ilex opaca</u>	<u>10</u>	<input checked="" type="checkbox"/> 0.0%	FAC
4. <u>Sabal palmetto</u>	<u>50</u>	<input type="checkbox"/> 0.0%	FAC
5. <u>Callicarpa americana</u>	<u>50</u>	<input type="checkbox"/> 0.0%	FACU
6. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>0</u> 20% of Total Cover: <u>0</u>	<u>0</u>	<b>= Total Cover</b>	
Herb Stratum (Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. <u>Callicarpa americana</u>	<u>5</u>	<input checked="" type="checkbox"/> 0.0%	FACU
2. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
3. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
4. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
5. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
6. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
7. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
8. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
9. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
10. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
11. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
12. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>3</u> 20% of Total Cover: <u>1</u>	<u>5</u>	<b>= Total Cover</b>	
Woody Vine Stratum (Plot size: <u>30'</u> )	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1. <u>Vitis rotundifolia</u>	<u>15</u>	<input checked="" type="checkbox"/> 0.0%	FAC
2. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
3. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
4. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
5. _____	<u>0</u>	<input type="checkbox"/> 0.0%	
50% of Total Cover: <u>8</u> 20% of Total Cover: <u>3</u>	<u>15</u>	<b>= Total Cover</b>	

**Dominance Test worksheet:**

Number of Dominant Species That are OBL, FACW, or FAC: 6 (A)

Total Number of Dominant Species Across All Strata: 7 (B)

Percent of dominant Species That Are OBL, FACW, or FAC: 0.0% (A/B)

**Prevalence Index worksheet:**

Total % Cover of:	Multiply by:
OBL species <u>55</u>	x 1 = <u>55</u>
FACW species <u>0</u>	x 2 = <u>0</u>
FAC species <u>65</u>	x 3 = <u>195</u>
FACU species <u>10</u>	x 4 = <u>40</u>
UPL species <u>0</u>	x 5 = <u>0</u>
Column Totals: <u>180</u> (A)	<u>290</u> (B)

Prevalence Index = B/A = 0.000 2.23

- Hydrophytic Vegetation Indicators:**
- 1 - Rapid Test for Hydrophytic Vegetation
  - 2 - Dominance Test is > 50%
  - 3 - Prevalence Index is ≤ 3.0<sup>1</sup>
  - Problematic Hydrophytic Vegetation<sup>1</sup> (Explain)
- <sup>1</sup> Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

**Definition of Vegetation Strata:**

**Tree** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and 3 in. (7.6 cm) or larger in diameter at breast height (DBH).

**Sapling** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and less than 3 in. (7.6 cm) DBH.

**Sapling/Shrub** - Woody plants, excluding vines, less than 3 in. DBH and greater than 3.28 ft (1m) tall.

**Shrub** - Woody plants, excluding woody vines, approximately 3 to 20 ft (1 to 6 m) in height.

**Herb** - All herbaceous (non-woody) plants, including herbaceous vines, regardless of size, and woody plants, except woody vines, less than approximately 3 ft (1 m) in height.

**Woody vine** - All woody vines, regardless of height.

**Hydrophytic Vegetation Present?** Yes  No

Remarks: (If observed, list morphological adaptations below).  
~~Open Water. This is a ditch that was historically cut through a wetland (swamp), therefore, is defined as a wetland per regulation (despite not currently meeting vegetative or soils criteria).~~ Wetland point was formerly in open water. USACE Biologist moved wetland point to edge of man-made canal. Very steep embankment. Point approximately 1 ft from existing OHWM.

**SOIL**

Sampling Point: Wetland 1

**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (Inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	T <sub>voe</sub> <sup>1</sup>	Loc <sup>2</sup>		
0-6	10YR 5/1	100	10YR 4/6	5	RM	PL	Sandy	
6-14	10YR 6/1	60					Sandy	
	10YR 7/1	40						Stripping

<sup>1</sup>Type: C=Concentration. D=Depletion. RM=Reduced Matrix, CS=Covered or Coated Sand Grains <sup>2</sup>Location: PL=Pore Lining, M=Matrix

<p><b>Hydric Soil Indicators:</b></p> <input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> Organic Bodies (A6) (LRR P, T, U) <input type="checkbox"/> 5 cm Mucky Mineral (A7) (LRR P, T, U) <input type="checkbox"/> Muck Presence (A8) (LRR U) <input type="checkbox"/> 1 cm Muck (A9) (LRR P, T) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Coast Prairie Redox (A16) (MLRA 150A) <input type="checkbox"/> Sandy Muck Mineral (S1) (LRR O, S) <input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input checked="" type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Dark Surface (S7) (LRR P, S, T, U)	<input type="checkbox"/> Polyvalue Below Surface (S8) (LRR S, T, U) <input type="checkbox"/> Thin Dark Surface (S9) (LRR S, T, U) <input type="checkbox"/> Loamy Mucky Mineral (F1) (LRR O) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8) <input type="checkbox"/> Marl (F10) (LRR U) <input type="checkbox"/> Depleted Ochric (F11) (MLRA 151) <input type="checkbox"/> Iron-Manganese Masses (F12) (LRR O, P, T) <input type="checkbox"/> Umbric Surface (F13) (LRR P, T, U) <input type="checkbox"/> Delta Ochric (F17) (MLRA 151) <input type="checkbox"/> Reduced Vertic (F18) (MLRA 150A, 150B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (MLRA 149A) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 149A, 153C, 153D)	<p><b>Indicators for Problematic Hydric Soils<sup>3</sup>:</b></p> <input type="checkbox"/> 1 cm Muck (A9) (LRR O) <input type="checkbox"/> 2 cm Muck (A10) (LRR S) <input type="checkbox"/> Reduced Vertic (F18) (outside MLRA 150A,B) <input type="checkbox"/> Piedmont Floodplain Soils (F19) (LRR P, S, T) <input type="checkbox"/> Anomalous Bright Loamy Soils (F20) (MLRA 153B) <input type="checkbox"/> Red Parent Material (TF2) <input type="checkbox"/> Very Shallow Dark Surface (TF12) <input type="checkbox"/> Other (Explain in Remarks)
--	--	--

<sup>3</sup>Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

<p><b>Restrictive Layer (if observed):</b></p> Type: _____ Depth (Inches): _____	<p><b>Hydric Soil Present?</b>    Yes <input checked="" type="radio"/>    No <input type="radio"/></p>
---	--

Remarks:  
~~This area is currently open water but was historically swamp that was dredged to create a ditch.~~

**WETLAND DETERMINATION DATA FORM - Atlantic and Gulf Coastal Plain Region**

Project/Site: Dead River Road City/County: Lake Sampling Date: 05-Feb-18  
 Applicant/Owner: DR Horton State: FL Sampling Point: Wetland 2  
 Investigator(s): James Modica IV Section, Township, Range: S 31 T 19S R 26E  
 Landform (hillslope, terrace, etc.): Flat Local relief (concave, convex, none): concave Slope: 0.0 % / 0.0 °  
 Subregion (LRR or MLRA): LRR U Lat.: 28.800605 Long.: -81.745690 Datum: \_\_\_\_\_  
 Soil Map Unit Name: 44-Swamp NWI classification: \_\_\_\_\_

Are climatic/hydrologic conditions on the site typical for this time of year? Yes  No  (If no, explain in Remarks.)  
 Are Vegetation , Soil , or Hydrology  significantly disturbed? Are "Normal Circumstances" present? Yes  No   
 Are Vegetation , Soil , or Hydrology  naturally problematic? (If needed, explain any answers in Remarks.)

**SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.**

Hydrophytic Vegetation Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Hydric Soil Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Wetland Hydrology Present? Yes <input checked="" type="radio"/> No <input type="radio"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="radio"/> No <input type="radio"/>
---	---

Remarks:  
 This is a small, isolated wetland.

**HYDROLOGY**

<b>Wetland Hydrology Indicators:</b> Primary Indicators (minimum of one required; check all that apply) <input checked="" type="checkbox"/> Surface Water (A1) <input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Marl Deposits (B15) (LRR U) <input checked="" type="checkbox"/> Saturation (A3) <input checked="" type="checkbox"/> Hydrogen Sulfide Odor (C1) <input checked="" type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Oxidized Rhizospheres along Living Roots (C3) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Other (Explain in Remarks) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input checked="" type="checkbox"/> Water-Stained Leaves (B9)	Secondary Indicators (minimum of 2 required) <input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Moss Trim Lines (B16) <input type="checkbox"/> Dry Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input checked="" type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> Shallow Aquitard (D3) <input checked="" type="checkbox"/> FAC-Neutral Test (D5) <input type="checkbox"/> Sphagnum moss (D8) (LRR T, U)
---	--

<b>Field Observations:</b> Surface Water Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Depth (Inches): <u>1</u> Water Table Present? Yes <input checked="" type="radio"/> No <input type="radio"/> Depth (Inches): _____ Saturation Present? (Includes capillary fringe) Yes <input type="radio"/> No <input checked="" type="radio"/> Depth (Inches): _____	Wetland Hydrology Present? Yes <input checked="" type="radio"/> No <input type="radio"/>
--	--

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

**VEGETATION (Five/Four Strata) - Use scientific names of plants.**

Sampling Point: **Wetland 2**

Tree Stratum	(Plot size: 30')	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	Quercus laurifolia	50	<input checked="" type="checkbox"/> 71.4%	FACW
2.	Pinus elliotii	10	<input checked="" type="checkbox"/> 28.6%	FACW
3.	Liquidambar styraciflua	10	<input type="checkbox"/> 0.0%	FAC
4.	Acer rubrum	15	<input type="checkbox"/> 0.0%	FAC
5.	Triadica sebifera	50	<input type="checkbox"/> 0.0%	FAC
6.		0	<input type="checkbox"/> 0.0%	
7.		0	<input type="checkbox"/> 0.0%	
8.		0	<input type="checkbox"/> 0.0%	
50% of Total Cover: <sup>45</sup> 35		20% of Total Cover: <sup>18</sup> 14	90 70 = Total Cover	
Sapling or Sapling/Shrub Stratum	(Plot size: 30')	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.		0	<input type="checkbox"/> 0.0%	FAC
2.		0	<input type="checkbox"/> 0.0%	FAC
3.		0	<input type="checkbox"/> 0.0%	FAC
4.		0	<input type="checkbox"/> 0.0%	FAC
5.		0	<input type="checkbox"/> 0.0%	
6.		0	<input type="checkbox"/> 0.0%	
7.		0	<input type="checkbox"/> 0.0%	
8.		0	<input type="checkbox"/> 0.0%	
50% of Total Cover: 0		20% of Total Cover: 0	0 = Total Cover	
Shrub Stratum	(Plot size: 30')	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	Sable palmeto	20	<input checked="" type="checkbox"/> 0.0%	FAC
2.	Triadica sebifera	20	<input type="checkbox"/> 0.0%	FAC
3.	Ilex opaca	50	<input type="checkbox"/> 0.0%	FAC
4.	Acer rubrum	10	<input type="checkbox"/> 0.0%	FAC
5.	Liquidambar styraciflua	50	<input type="checkbox"/> 0.0%	FAC
6.		0	<input type="checkbox"/> 0.0%	
50% of Total Cover: 20		20% of Total Cover: 9 0	40 = Total Cover	
Herb Stratum	(Plot size: 30')	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	Saururus cernuus	30	<input checked="" type="checkbox"/> 100.0%	OBL
2.	Colocasia esculenta	50	<input type="checkbox"/> 0.0%	FACW
3.		0	<input type="checkbox"/> 0.0%	
4.		0	<input type="checkbox"/> 0.0%	
5.		0	<input type="checkbox"/> 0.0%	
6.		0	<input type="checkbox"/> 0.0%	
7.		0	<input type="checkbox"/> 0.0%	
8.		0	<input type="checkbox"/> 0.0%	
9.		0	<input type="checkbox"/> 0.0%	
10.		0	<input type="checkbox"/> 0.0%	
11.		0	<input type="checkbox"/> 0.0%	
12.		0	<input type="checkbox"/> 0.0%	
50% of Total Cover: 15		20% of Total Cover: 6	30 = Total Cover	
Woody Vine Stratum	(Plot size: 30')	Absolute % Cover	Dominant Species? Rel.Strat. Cover	Indicator Status
1.	Vitis rotundifolia	15	<input type="checkbox"/> 0.0%	FAC
2.		0	<input type="checkbox"/> 0.0%	
3.		0	<input type="checkbox"/> 0.0%	
4.		0	<input type="checkbox"/> 0.0%	
5.		0	<input type="checkbox"/> 0.0%	
50% of Total Cover: 0		20% of Total Cover: 3 0	15 = Total Cover	

**Dominance Test worksheet:**

Number of Dominant Species That are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of dominant Species That Are OBL, FACW, or FAC: 100.0% (A/B)

**Prevalence Index worksheet:**

Total % Cover of: 30 Multiply by:

OBL species 30 x 1 = 30

FACW species 65 ~~70~~ x 2 = 130 ~~140~~

FAC species 87 ~~0~~ x 3 = 261 ~~0~~

FACU species 0 x 4 = 0

UPL species 0 x 5 = 0

Column Totals: 182 ~~100~~ (A) 421 ~~170~~ (B)

Prevalence Index = B/A = 1.700 <sup>2.31</sup>

**Hydrophytic Vegetation Indicators:**

1 - Rapid Test for Hydrophytic Vegetation

2 - Dominance Test is > 50%

3 - Prevalence Index is ≤ 3.0 <sup>1</sup>

Problematic Hydrophytic Vegetation <sup>1</sup> (Explain)

<sup>1</sup> Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

**Definition of Vegetation Strata:**

**Tree** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and 3 in. (7.6 cm) or larger in diameter at breast height (DBH).

**Sapling** - Woody plants, excluding woody vines, approximately 20 ft (6 m) or more in height and less than 3 in. (7.6 cm) DBH.

**Sapling/Shrub** - Woody plants, excluding vines, less than 3 in. DBH and greater than 3.28 ft (1m) tall.

**Shrub** - Woody plants, excluding woody vines, approximately 3 to 20 ft (1 to 6 m) in height.

**Herb** - All herbaceous (non-woody) plants, including herbaceous vines, regardless of size, and woody plants, except woody vines, less than approximately 3 ft (1 m) in height.

**Woody vine** - All woody vines, regardless of height.

**Hydrophytic Vegetation Present?** Yes  No

Remarks: (If observed, list morphological adaptations below).

\*Indicator suffix = National status or professional decision assigned because Regional status not defined by FWS.

**SOIL**

Sampling Point: Wetland 2

**Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)**

Depth (Inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	T <sub>voe</sub> <sup>1</sup>	Loc <sup>2</sup>		
0-2	10YR	2/1					Muck	
2-5	10YR	3/1						
5-12	10YR	5/1						
0-6	10YR 2/1	100					Loam/Sandy	
6-10	10YR 3/1	50					Sandy, 70% coated grains	
	10YR5/1	50						
10-14	10YR 3/1	100					Coarse sand, 50% coated grain	

<sup>1</sup>Type: C=Concentration. D=Depletion. RM=Reduced Matrix, CS=Covered or Coated Sand Grains <sup>2</sup>Location: PL=Pore Lining, M=Matrix

**Hydric Soil Indicators:**

- Histosol (A1)
- Histic Epipedon (A2)
- Black Histic (A3)
- Hydrogen Sulfide (A4)
- Stratified Layers (A5)
- Organic Bodies (A6) (LRR P, T, U)
- 5 cm Mucky Mineral (A7) (LRR P, T, U)
- Muck Presence (A8) (LRR U)
- 1 cm Muck (A9) (LRR P, T)
- Depleted Below Dark Surface (A11)
- Thick Dark Surface (A12)
- Coast Prairie Redox (A16) (MLRA 150A)
- Sandy Muck Mineral (S1) (LRR O, S)
- Sandy Gleyed Matrix (S4)
- Sandy Redox (S5)
- Stripped Matrix (S6)
- Dark Surface (S7) (LRR P, S, T, U)

- Polyvalue Below Surface (S8) (LRR S, T, U)
- Thin Dark Surface (S9) (LRR S, T, U)
- Loamy Mucky Mineral (F1) (LRR O)
- Loamy Gleyed Matrix (F2)
- Depleted Matrix (F3)
- Redox Dark Surface (F6)
- Depleted Dark Surface (F7)
- Redox Depressions (F8)
- Marl (F10) (LRR U)
- Depleted Ochric (F11) (MLRA 151)
- Iron-Manganese Masses (F12) (LRR O, P, T)
- Umbric Surface (F13) (LRR P, T, U)
- Delta Ochric (F17) (MLRA 151)
- Reduced Vertic (F18) (MLRA 150A, 150B)
- Piedmont Floodplain Soils (F19) (MLRA 149A)
- Anomalous Bright Loamy Soils (F20) (MLRA 149A, 153C, 153D)

**Indicators for Problematic Hydric Soils<sup>3</sup>:**

- 1 cm Muck (A9) (LRR O)
- 2 cm Muck (A10) (LRR S)
- Reduced Vertic (F18) (outside MLRA 150A,B)
- Piedmont Floodplain Soils (F19) (LRR P, S, T)
- Anomalous Bright Loamy Soils (F20) (MLRA 153B)
- Red Parent Material (TF2)
- Very Shallow Dark Surface (TF12)
- Other (Explain in Remarks)

<sup>3</sup>Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

**Restrictive Layer (if observed):**

Type: \_\_\_\_\_  
 Depth (Inches): \_\_\_\_\_

Hydric Soil Present? Yes  No

**Remarks:**

1 inch of duff layer over soil.



## Dead River

Figure 1 - Location Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida



**MODICA & ASSOCIATES**  
 302 Mohawk Road  
 Clermont, Florida 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)



 Boundary

\* Background imagery obtained from ESRI online Basemaps.  
 \* Property boundary obtained from Lake County Property Appraiser.


DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus  
 JSRS, AEX, Getmapping, Aerogrid, IGN, IGP, swisstopo, and  
 the GIS User Community

## Dead River

Figure 2 - Aerial Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida




**MODICA & ASSOCIATES**  
 302 Mohawk Road  
 Clermont, Florida 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)

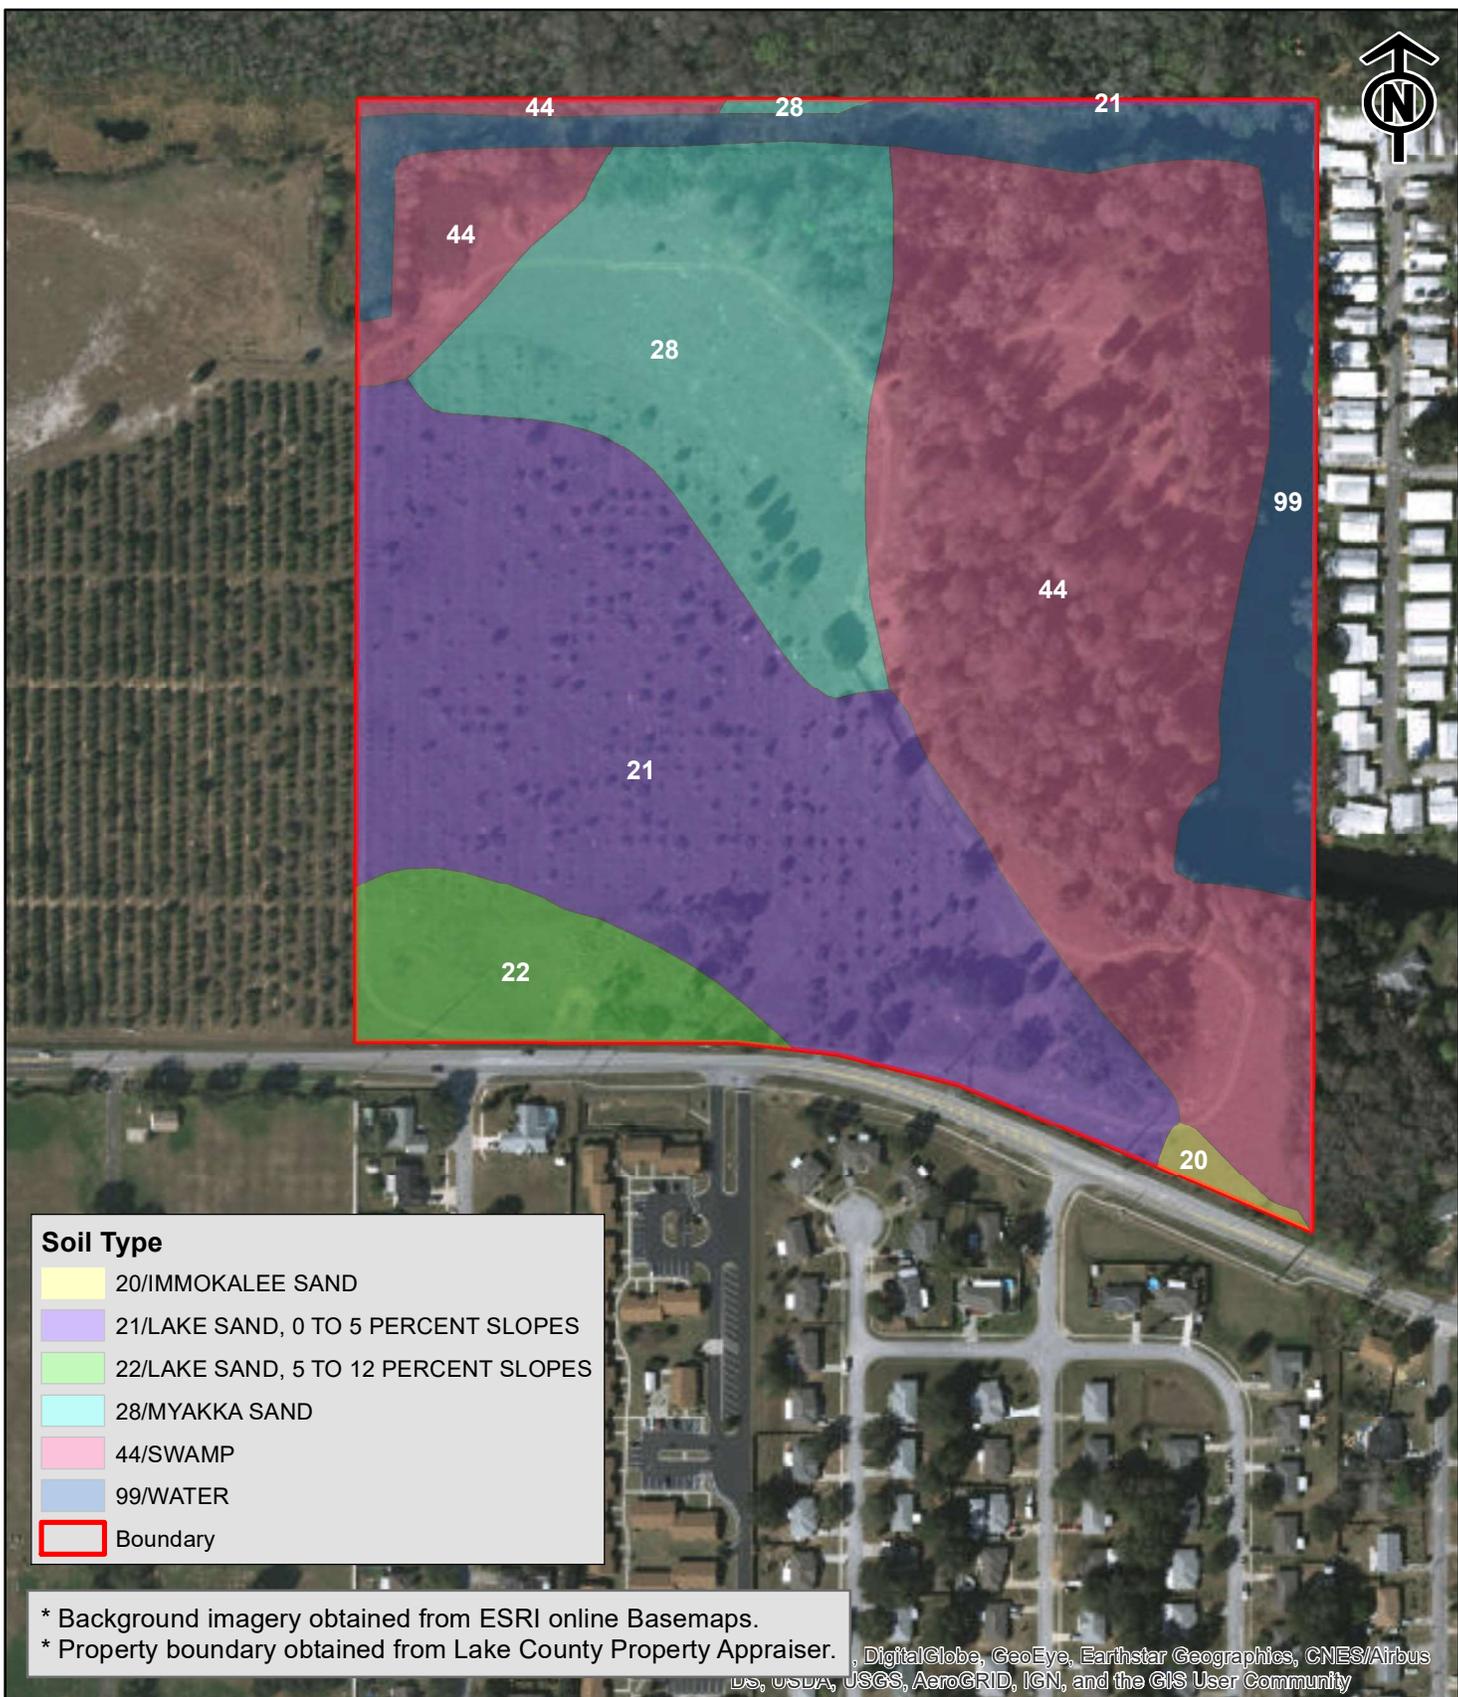


## Dead River

Figure 3 - Soils Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida

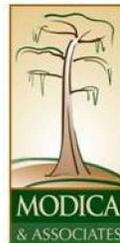

**Modica & Associates, Inc.**  
*Environmental Planning, Design & Permitting*  
 302 Mohawk Road  
 Clermont, FL 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)

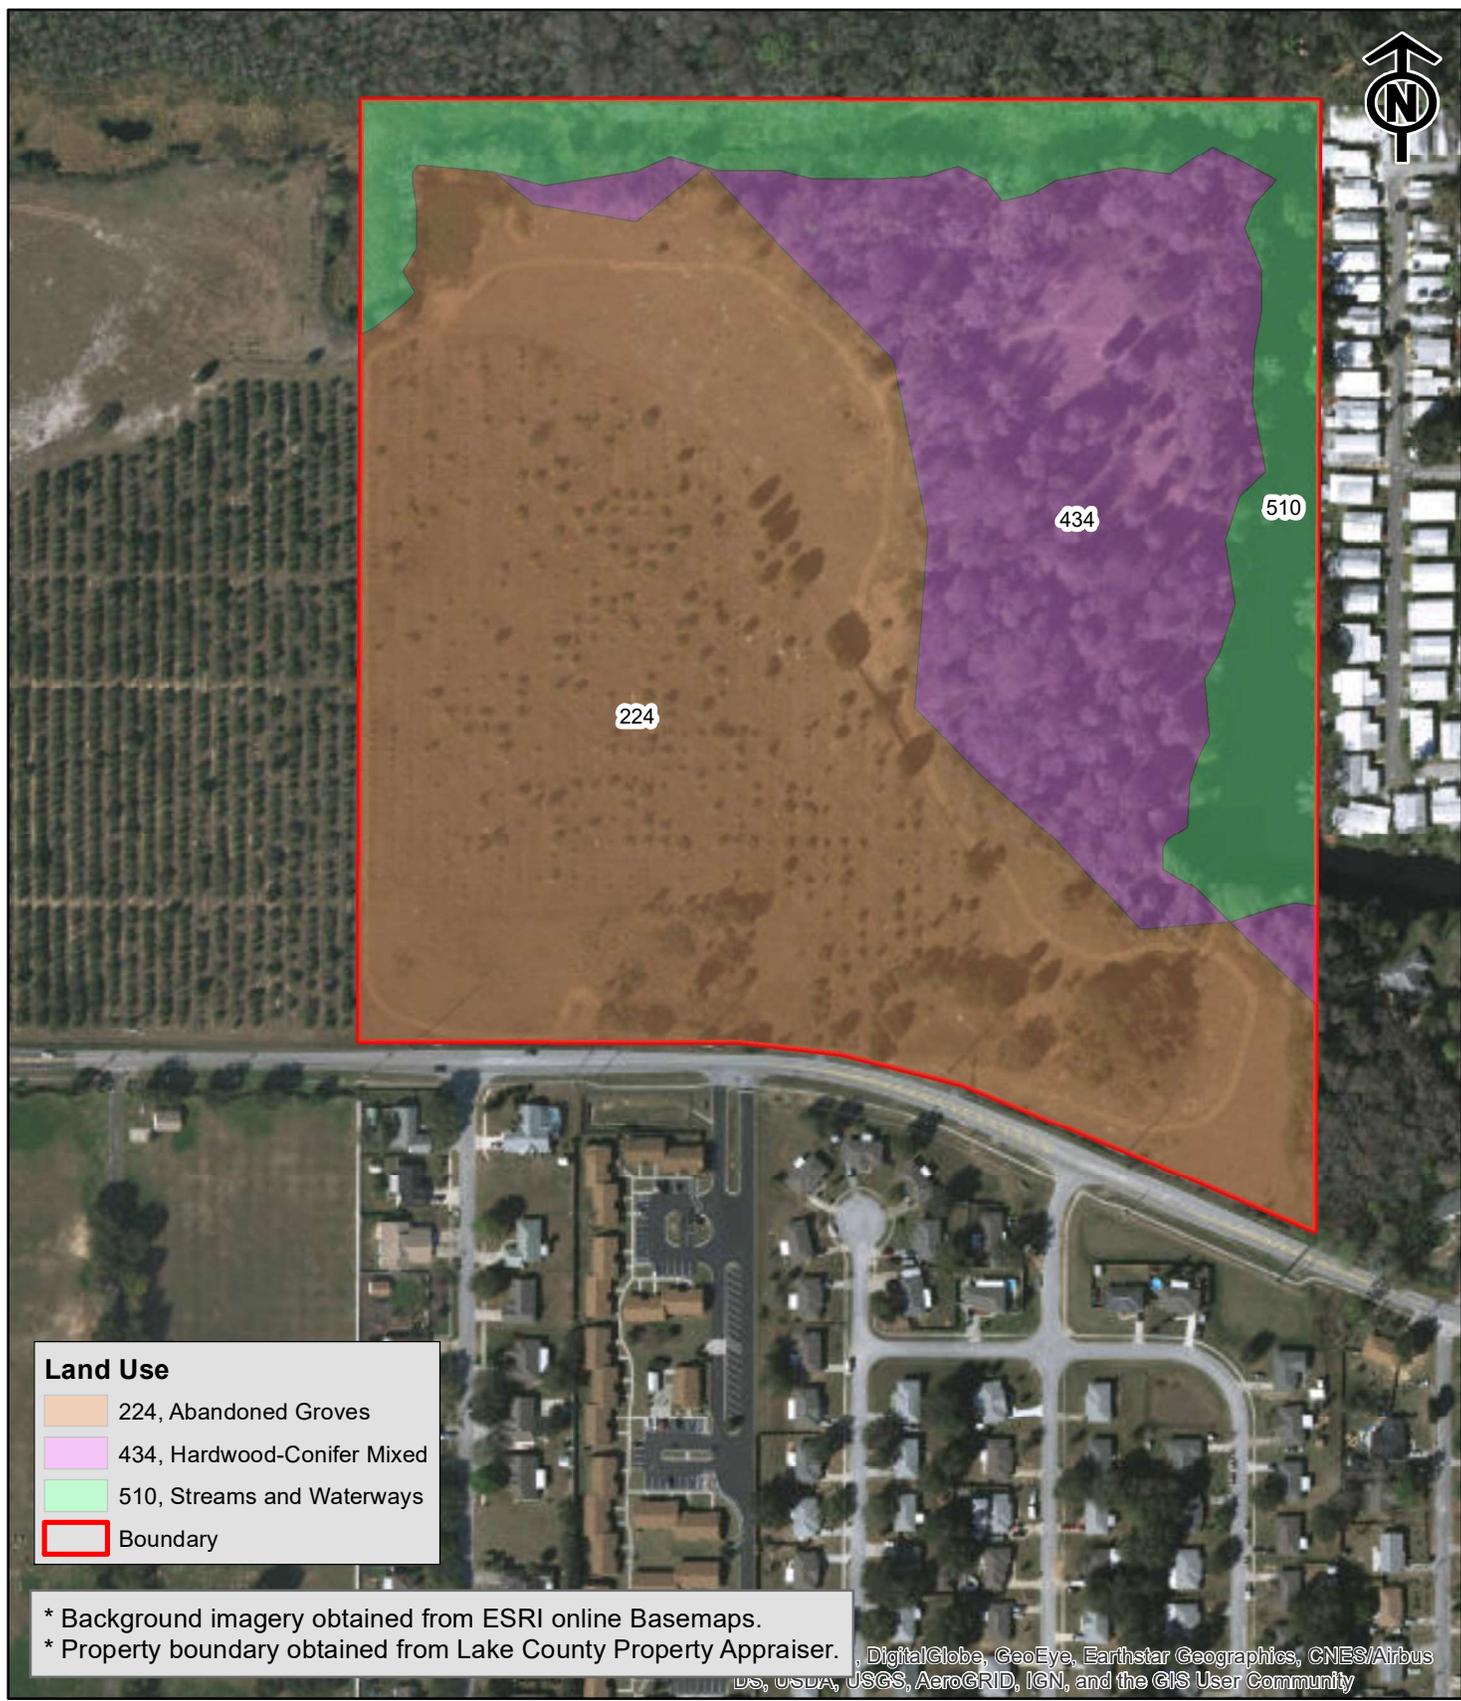


Land Use	
	224, Abandoned Groves
	434, Hardwood-Conifer Mixed
	510, Streams and Waterways
	Boundary

\* Background imagery obtained from ESRI online Basemaps.  
 \* Property boundary obtained from Lake County Property Appraiser.


© 2011 DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus  
 DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community

## Dead River

Figure 4 - Land Use Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida

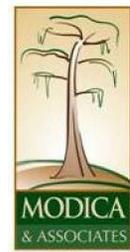

**Modica & Associates, Inc.**  
*Environmental Planning, Design & Permitting*  
 302 Mohawk Road  
 Clermont, FL 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)

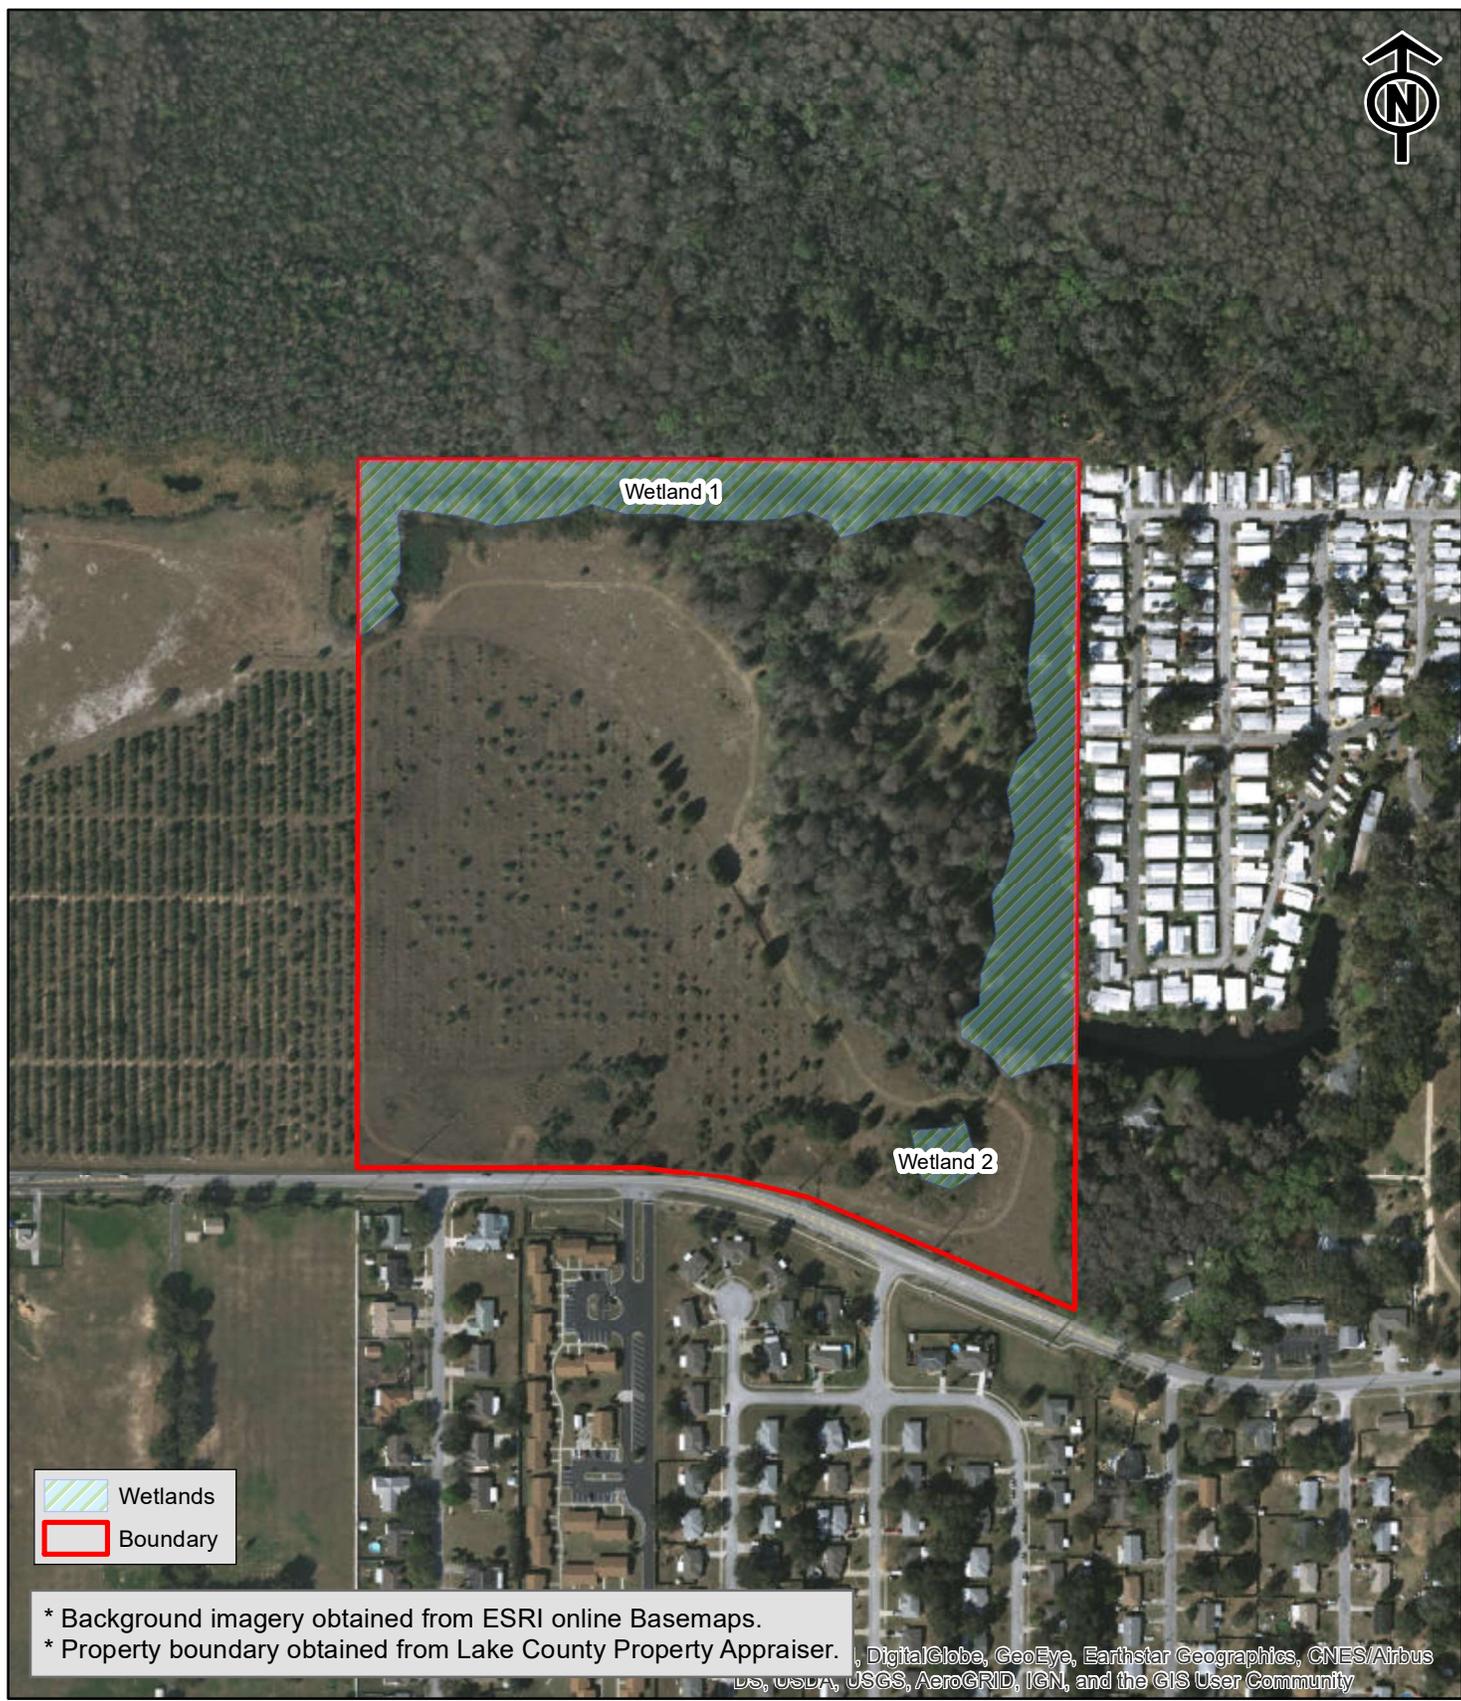


# Dead River Road

Figure 5- Wetlands Map Section  
 30 and 31, T19S, R26E Lake  
 County, Florida



**MODICA & ASSOCIATES**  
 302 Mohawk Road  
 Clermont, Florida 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)

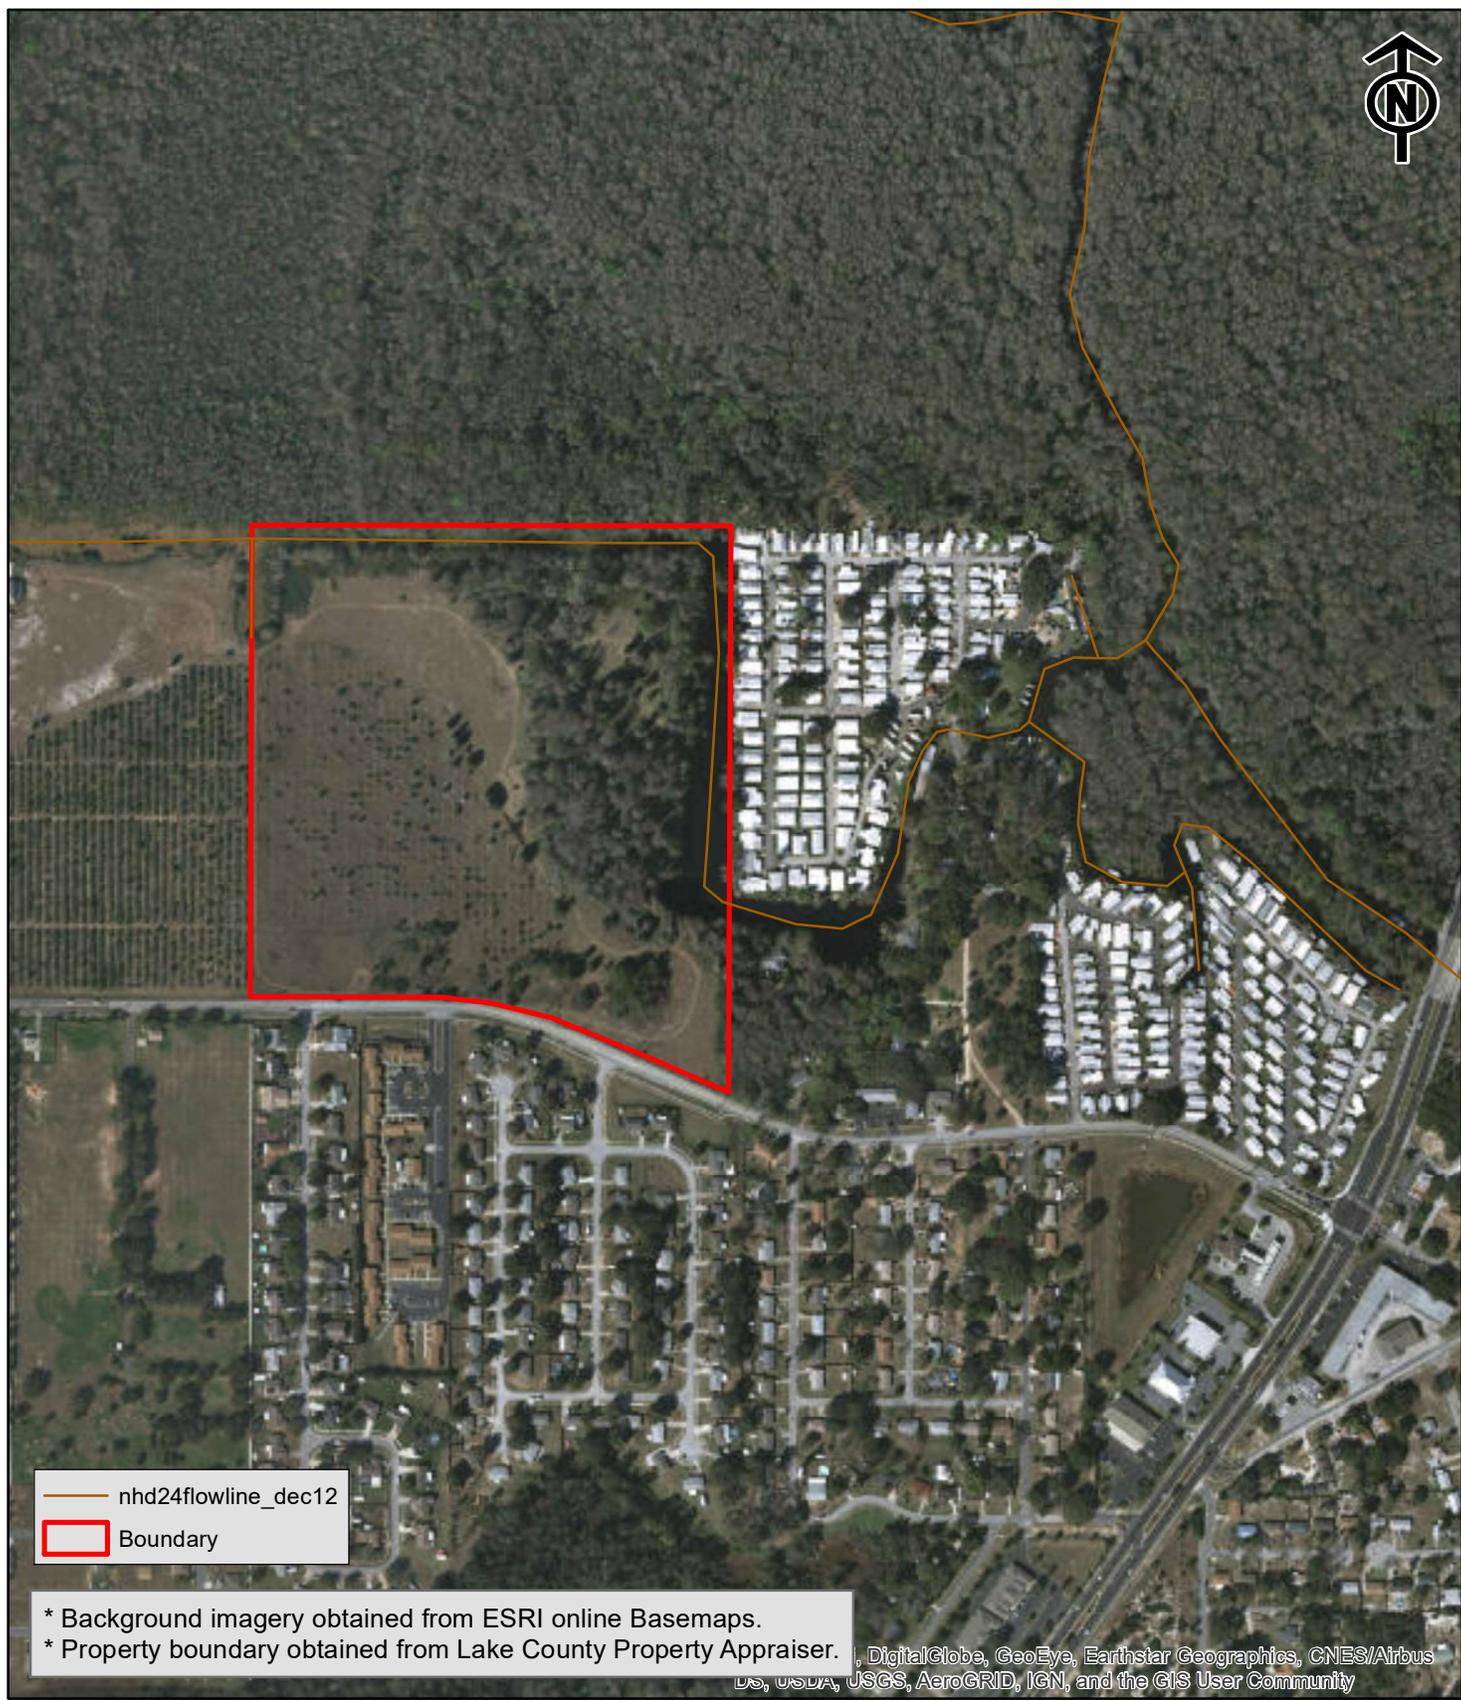

— nhd24flowline\_dec12  
□ Boundary

\* Background imagery obtained from ESRI online Basemaps.  
\* Property boundary obtained from Lake County Property Appraiser. DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus  
DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community

## Dead River Road

Figure 6- NHD Flowline Map  
Section 30 and 31, T19S, R26E  
Lake County, Florida



MODICA & ASSOCIATES  
302 Mohawk Road  
Clermont, Florida 34715  
Phone: (352) 394-2000  
Fax: (352) 394-1159  
Email: Environmental@Modica.cc  
www.ModicaAndAssociates.com



## Dead River Road

Figure 7- Route to TNW Map  
Section 30 and 31, T19S, R26E  
Lake County, Florida



MODICA & ASSOCIATES  
302 Mohawk Road  
Clermont, Florida 34715  
Phone: (352) 394-2000  
Fax: (352) 394-1159  
Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)



## Dead River Road

Figure 8- Sampling Points Map  
Section 30 and 31, T19S, R26E  
Lake County, Florida



MODICA & ASSOCIATES  
302 Mohawk Road  
Clermont, Florida 34715  
Phone: (352) 394-2000  
Fax: (352) 394-1159  
Email: [Environmental@Modica.cc](mailto:Environmental@Modica.cc)  
[www.ModicaAndAssociates.com](http://www.ModicaAndAssociates.com)



- FL\_Wetlands
- Boundary


\* Background imagery obtained from ESRI online Basemaps.  
\* Property boundary obtained from Lake County Property Appraiser.  
DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus  
DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community

### Dead River Road

Figure 9- NWI Map  
Section 30 and 31, T19S, R26E  
Lake County, Florida



MODICA & ASSOCIATES  
302 Mohawk Road  
Clermont, Florida 34715  
Phone: (352) 394-2000  
Fax: (352) 394-1159  
Email: Environmental@Modica.cc  
www.ModicaAndAssociates.com

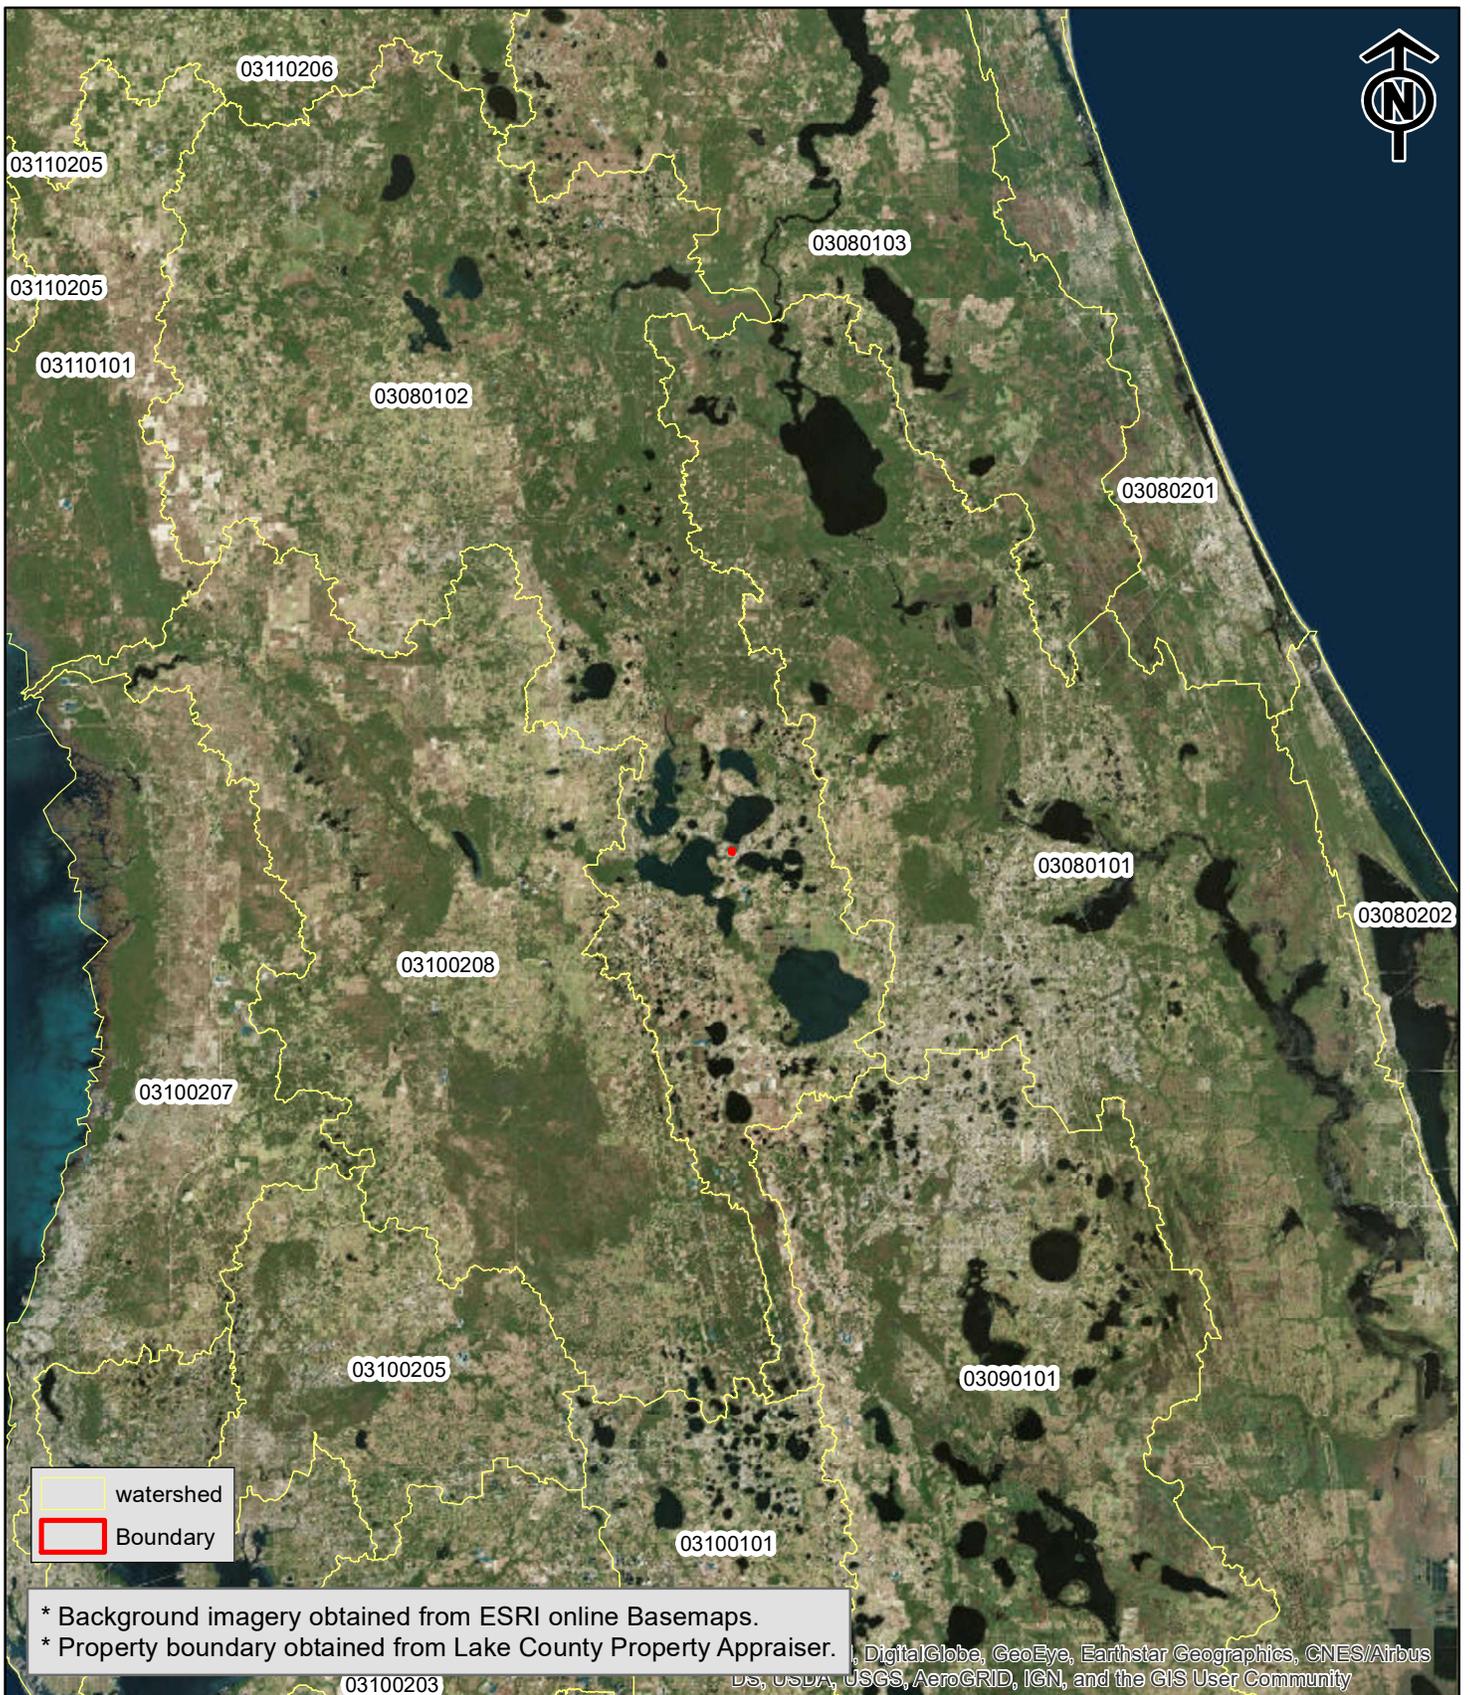

## Dead River Road

Figure 10- HUC 8 Digit Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida



MODICA & ASSOCIATES  
 302 Mohawk Road  
 Clermont, Florida 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: Environmental@Modica.cc  
 www.ModicaAndAssociates.com



WBDHU12  
 Boundary

\* Background imagery obtained from ESRI online Basemaps.  
 \* Property boundary obtained from Lake County Property Appraiser.

DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus  
 USGS, AeroGRID, IGN, and the GIS User Community

## Dead River Road

Figure 11- HUC 12 Digit Map  
 Section 30 and 31, T19S, R26E  
 Lake County, Florida

**MODICA & ASSOCIATES**  
 302 Mohawk Road  
 Clermont, Florida 34715  
 Phone: (352) 394-2000  
 Fax: (352) 394-1159  
 Email: Environmental@Modica.cc  
 www.ModicaAndAssociates.com



# National Flood Hazard Layer FIRMMette



28°48'27.38"N



## Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

SPECIAL FLOOD HAZARD AREAS		Without Base Flood Elevation (BFE) Zone A, V, A99
		With BFE or Depth
		Regulatory Floodway Zone AE, AO, AH, VE, AR
OTHER AREAS OF FLOOD HAZARD		0.2% Annual Chance Flood Hazard, Areas of 1% annual chance flood with average depth less than one foot or with drainage areas of less than one square mile Zone X
		Future Conditions 1% Annual Chance Flood Hazard Zone X
		Area with Reduced Flood Risk due to Levee. See Notes. Zone X
		Area with Flood Risk due to Levee Zone D
		Area of Minimal Flood Hazard Zone X
OTHER AREAS		Effective LOMRs
		Area of Undetermined Flood Hazard Zone D
GENERAL STRUCTURES		Channel, Culvert, or Storm Sewer
		Levee, Dike, or Floodwall
OTHER FEATURES		20.2 Cross Sections with 1% Annual Chance Water Surface Elevation
		17.5
		Coastal Transect
		Base Flood Elevation Line (BFE)
		Limit of Study
MAP PANELS		Jurisdiction Boundary
		Coastal Transect Baseline
		Profile Baseline
		Hydrographic Feature
MAP PANELS		Digital Data Available
		No Digital Data Available
		Unmapped



This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The base map shown complies with FEMA's base map accuracy standards

The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 5/30/2018 at 12:16:17 PM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: base map imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.

0 250 500 1,000 1,500 2,000 Feet 1:6,000

28°47'55.85"N

81°44'18.92"W

1941

NITRATE P



1941

CTS - 4E



1947



1958



1974





1974

1974

